CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRRES20236296

Address: 2124 SW HOLDBROOKS DR, LEES SUMMIT, MO 640822122 SW HOLDBROOKS DR, LEES SUMMIT,

MO 64082

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Outcome: Date:

Occupancy Inspection - Codes Kyle Beard Failed Thursday, May 30, 2024

Residential

Corrective Action Required:

1 Miscellaneous 2122 and 2124 SW Holdbrooks. Occupancy

Correction

2122

Front porch guard rail height from the concrete to the bottom rail is over the

code 4 inches from the surface

First step up from the entry to the stairs has a greater than 7 3/4 inches code

required riser height

Back porch security lights are only 89 inches in height

Back porch base stair landing is not installed Back porch needs a hand rail installed to code

Remove dust covers from ceiling mounted detectors

Fire block all holes in garage at over head garage door to ceiling

Seal all gaps under chase in garage

Stairwell to basement does not have the code required 6'8" of head

clearance height near the bottom

Hot water heater needs a lock out installed at the electrical panel

Test button on breaker #17 does not work

2124

Bottom rail of front porch guard rail is over 4 inches in height. Code is no

more than 4 inches

Entry to first step up stairs has a riser height of greater than the code allowance of 7 3/4 inches

Back porch GFCI does not trip

Back porch security light is not at least 8 feet off the floor surface

Back porch base of stair landing is not installed

Fire block all holes in garage at overhead door to ceiling

Seal the bottom sides of the chase in the garage

Basement step to main entry has a greater riser height than the code allowable 7 3/4 inches

Stairwell to the basement does not have the code required head height of 6'8" near the bottom of the stairs

Attic access panel is not installed in the upper floor

Exterior electrical box needs a cover installed

Seal exterior penetration at the gas line to siding

Both units

Driveway and sidewalk finals needs to pass sod, splash pads and sump pump extensions are not installed Final grading is not done for a plot plan inspection

Comments: