CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 **DEVSERVICES.CITYOFLS.NET**

Inspection Summary

Permit #:PRRES20234858Address:2147 NW KILLARNEY LN, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:		Inspector:	Outcome:	Date:
All Rough Inspection - Residential		Alex Fischer	Not Ready	Thursday, June 06, 2024
Correctiv	e Action Required:			
1	Misc	 -Missing blocking above I beam in garage -Missing supports at soffit in garage -Loose vent connection at bathroom fan near garage/kitchen area -Missing Simpson H2 5A or similar rafter ties throughout -Secure gas line at fireplace -Missing collar ties at covered deck -Use approved means to connect fans to bathroom vents throughout -Add more security blocking at front door -Missing fire blocking at back upstairs bedroom top plate -Missing fire blocking top plate in basement near DWV east side -Missing supports at soffit in basement -Missing ufer and gas line grounding conductor 		
Partial Co	prrection:			
2	Misc	Previous list was inc	onclusive. see complete	list.
		-Fire stop soffit and	arage wall.	
		have engineer addre	arage wall bored through edge of plate install correctly or ress issue. it notched for second-floor shower over two car garage.	

-Can light and Romex in return air over pantry room off garage.

-Electrical box in r/a garage pantry wall.

-Master deck door not installed .?

-Protect Romex board holes through studs left of kitchen hood under LVL. -Deck post not continuous.

-Install all LIB bracing first and second floor were required by plan. -Install fireplace and for inspection.

-Terminate all electrical in boxes, fireplace, stairwell, sconce, tile grounds, and Romex hanging out of soffit with mechanical connection.
-Use approved material for fire stopping, not half-inch siding. Over fireplace, etc.

Basement -

-Terminate Romex in a box in soffit missing Canlite. Fire stop columns for being post vertical horizontal.

-Fire stop ends of drop ceilings vertical to horizontal from wall.

-Open concrete trench from bar sink wall install electrical conduit.

-Install lateral bracing at ceiling joist above lower bedroom at end.

-Remove sidelong and cover in deck framing , no support u get lvl ridge. Or provide engineers report .

-Install post to beam connections at deck per plans. Plan shows for steel post, revise plans or provide approved engineers design.

Comments: