# CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

# **DEVSERVICES.CITYOFLS.NET**

# **Inspection Summary**

Permit #: PRRES20236557

Address: 3723 SW CLAYTON PL, LEES SUMMIT, MO 640823725 SW CLAYTON PL, LEES SUMMIT, MO

640823727 SW CLAYTON PL, LEES SUMMIT, MO 640823721 SW CLAYTON PL, LEES

**SUMMIT, MO 64082** 

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

Occupancy Inspection - Codes Kyle Beard Failed Thursday, July 11, 2024

Residential

Corrective Action Required:

1 Miscellaneous 3721-3723-3725 and 3727 SW Clayton

Correction Occupancy

3721

Kitchen electrical receptacles do not trip

Missing anti water hammer arrestor under kitchen sink

First stair riser from main floor going up has a height of 8 inches

Garage to house self closing hinge is not working Fire block all holes in sheet rock in garage at ceiling

Seal bottom of chases in garage

Stairwell going to basement at intermediate platform does not have the

code required 36 inches of travel distance

Handrail at the basement bottom step does not meet at stair nosing Electrical wires are exposed at basement bathroom for lighting fixture

Electrical Ufer is not exposed Electrical panel is not labeled

Top of stairs to upper floor landing has a riser height greater then the code

allowed 73/4 inches

Water anti hammer arrestor in utility room is not installed

# GFCI in utility room will not reset

### 3723

Kitchen electrical receptacles are not working
Anti water hammer arrestor under kitchen sink is not installed
First stair riser up from floor has a height of 8 inches
Fire block all holes in sheet rock in garage to ceiling
Seal bottom of chases in garage
Last riser up from the basement to the main floor has a height greater than
the code allowable 7 3/4 inches
Electrical panel is not labeled
GFCI in basement does not work
Water hammer arrestor is not installed in utility room

### 3725 and 3727

Not inspected due to reoccurring deficiencies in other units

# NOT A COMPLETE LIST

### All units

Sod, splash pads and patio stair landing s are not installed Seal top of meter cans Seal all exterior penetrations at siding Nails missing in back patio joist hangers

# **Comments:**