

CITY OF LEE'S SUMMIT  
Development Services Department  
220 SE Green Street  
Lee's Summit, MO 64063  
(816)969-1200  
**DEVSERVICES.CITYOFLS.NET**

## Inspection Summary

Permit #: PRRES20236557  
Address: 3723 SW CLAYTON PL, LEES SUMMIT, MO 640823725 SW CLAYTON PL, LEES SUMMIT, MO  
640823727 SW CLAYTON PL, LEES SUMMIT, MO 640823721 SW CLAYTON PL, LEES  
SUMMIT, MO 64082

---

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
<b>Occupancy Inspection - Codes Residential</b>	Kyle Beard	Not Ready	Thursday, July 11, 2024

Corrective Action Required:

1	Miscellaneous Correction	3721-3723-3725 and 3727 SW Clayton Occupancy  3721 Kitchen electrical receptacles do not trip Missing anti water hammer arrestor under kitchen sink First stair riser from main floor going up has a height of 8 inches Garage to house self closing hinge is not working Fire block all holes in sheet rock in garage at ceiling Seal bottom of chases in garage Stairwell going to basement at intermediate platform does not have the code required 36 inches of travel distance Handrail at the basement bottom step does not meet at stair nosing Electrical wires are exposed at basement bathroom for lighting fixture Electrical Ufer is not exposed Electrical panel is not labeled Top of stairs to upper floor landing has a riser height greater then the code allowed 7 3/4 inches Water anti hammer arrestor in utility room is not installed
---	--------------------------	--

GFCI in utility room will not reset

3723

Kitchen electrical receptacles are not working

Anti water hammer arrestor under kitchen sink is not installed

First stair riser up from floor has a height of 8 inches

Fire block all holes in sheet rock in garage to ceiling

Seal bottom of chases in garage

Last riser up from the basement to the main floor has a height greater than the code allowable 7 3/4 inches

Electrical panel is not labeled

GFCI in basement does not work

Water hammer arrestor is not installed in utility room

3725 and 3727

Not inspected due to reoccurring deficiencies in other units

NOT A COMPLETE LIST

All units

Sod, splash pads and patio stair landings are not installed

Seal top of meter cans

Seal all exterior penetrations at siding

Nails missing in back patio joist hangers

NOT READY FOR INSPECTION

**Comments:**