# CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

# **DEVSERVICES.CITYOFLS.NET**

# **Inspection Summary**

Permit #: PRRES20236557

Address: 3723 SW CLAYTON PL, LEES SUMMIT, MO 640823725 SW CLAYTON PL, LEES SUMMIT, MO

640823727 SW CLAYTON PL, LEES SUMMIT, MO 640823721 SW CLAYTON PL, LEES

**SUMMIT, MO 64082** 

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

Occupancy Inspection - Codes Kyle Beard Failed Friday, July 12, 2024

Residential

Corrective Action Required:

1 Miscellaneous 3721-3723-3725 and 3727 SW Clayton

Correction Occupancy

3721

Kitchen electrical receptacles do not trip

Missing anti water hammer arrestor under kitchen sink

First stair riser from main floor going up has a height of 8 inches

Garage to house self closing hinge is not working Fire block all holes in sheet rock in garage at ceiling

Seal bottom of chases in garage

Stairwell going to basement at intermediate platform does not have the

code required 36 inches of travel distance

Handrail at the basement bottom step does not meet at stair nosing Electrical wires are exposed at basement bathroom for lighting fixture

Electrical Ufer is not exposed Electrical panel is not labeled

Top of stairs to upper floor landing has a riser height greater then the code

allowed 7 3/4 inches

Water anti hammer arrestor in utility room is not installed

# GFCI in utility room will not reset

# 3723

Kitchen electrical receptacles are not working
Anti water hammer arrestor under kitchen sink is not installed
First stair riser up from floor has a height of 8 inches
Fire block all holes in sheet rock in garage to ceiling
Seal bottom of chases in garage
Last riser up from the basement to the main floor has a height greater than the code allowable 7 3/4 inches
Electrical panel is not labeled
GFCI in basement does not work
Water hammer arrestor is not installed in utility room

### All units

Sod, splash pads and patio stair landing s are not installed Seal top of meter cans Seal all exterior penetrations at siding Nails missing in back patio joist hangers

hot water heater in electrical panel needs a lock out installed

### 3727 and 3725.

### 3727

Ceiling in basement does not have 6'8" of head clearance
Landing in hallway going to the basement does not have 36 inches of travel
distance
Kitchen backsplash GFCI is not working
Back porch electrical receptacle cover needs to be replaced
Front porch needs a guardrail installed
Bathroom 1 GFCI does not work
Top riser to upper floor has a greater than 7 3/4 inches in height
Fire block bottom of chases in the garage

# 3725

Address numbers need to be lowered for proper illumination Hot water heater hot water side is in contact with 12/2 electrical wire and whip

First riser step down from the main living room has a height greater then 7 3/4 inches

Some electrical receptacles and switches have gaps next to them Fire block bottom of chases in garage

- -Exterior splash pads, sump pump extensions Are not installed
- -Seal all exterior penetrations
- -Back patio landing pads are not installed

-Plot grading is not completed

Units 3723 and 3721 are listed separately

**Comments:**