CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 **DEVSERVICES.CITYOFLS.NET**

Inspection Summary

Permit #: PRRES20241766 Address: 2066 NW OBRIEN RD, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Robb Popp	Not Ready	Friday, September 27, 2024
NO FURTHER INSPECT REPORT	TIONS UNTIL EROSION CO	NTROL IS IN COMPLIANCE-SEE
-complete plumbing -provide attic access WITHIN 6' OF ACCESS -fire block wall space fire down, kitchen de IN GARAGE, BLOCK O WALL SPACE -missing roof boots-I -address studs overb -uncover covered pa -missing multiple flo stud pack -uncover sheathing a HANGERS THROUGHO -strap top plates at fr	above garage-NOT DONE for ceiling space above ga to ceiling space at owne ead spaces into furr down FF CORNERS OF KITCHEN NOT DONE oard for bath 4 dwv-NOT tio for inspection-NOT DO or joists above dining roc t front entry to inspection OUT ont entry/dining room w ON AS WELL	arage-PROTECT ELECTRICAL rs entry/garage-hvac chase and in garage-SEAL GSPS AT DWV FUR DOWN CEILING LINE TO DONE DNE om-MISSING TRIPLE AND (5) 2x4 n nailing-PROVIDE JOIST all to adjoining-STRAP
	NO FURTHER INSPECT REPORT -lib's to be installed to -complete plumbing -provide attic access WITHIN 6' OF ACCESS -fire block wall space fire down, kitchen de IN GARAGE, BLOCK O WALL SPACE -missing roof boots-N -address studs overb -uncover covered pat -missing multiple flo stud pack -uncover sheathing a HANGERS THROUGHO -strap top plates at fr UPSTAIRS CONNECTION	NO FURTHER INSPECTIONS UNTIL EROSION CO REPORT -lib's to be installed to plans (see sizing and pl -complete plumbing above garage-NOT DONE -provide attic access for ceiling space above ga WITHIN 6' OF ACCESS -fire block wall space to ceiling space at owne fire down, kitchen dead spaces into furr down IN GARAGE, BLOCK OFF CORNERS OF KITCHEN WALL SPACE -missing roof boots-NOT DONE -address studs overboard for bath 4 dwv-NOT -uncover covered patio for inspection-NOT DO -missing multiple floor joists above dining roof

-missing multiple truss hangers and multiple hangers incorrect size-MASTER CLOSET, MASTER BATHROOM,

-missing lateral bracing throughout m-C7,

-anchor bolts in basement to be in the middle 1/3 of sill plate-NOT DONE

NOT READY

Comments: