## CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

## **DEVSERVICES.CITYOFLS.NET**

## **Inspection Summary**

Permit #: PRCOM20232768

Address: 810 NW WARD RD, LEES SUMMIT, MO 64086

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

corrective actions have been completed. Do not cover any work until approved.				
Inspection:		Inspector:	Outcome:	Date:
All Rough Inspection - Commercial		Robb Popp	Partial	Friday, October 04, 2024
Corrective Action Required:				
1	STAIR TOWER 1	Stair tower 1 in Building F: -Shear wall nailng pattern behind stringers at floors 1-3 *OK for first layer all floors inside of stairwell		
Corrective Action Required:				
2	STAIR TOWER 2	-Stair tower 2 in building G -Shear wall nailing pattern behind stringers at floors 1-2		
Correctiv	e Action Required:	-Shear wall halling patter	n benind stringers at floors	1-2
3	STAIR TOWER 3	-Stair tower 3 in building.	1	
3	STAIR TOWERS		n behind stringers floors 1-:	3
Corrective Action Required:				
4	FIRST FLOOR			
Corrective Action Required:				
5	SECOND FLOOR	Building F:		
		-Behind tubs and showers	s ok to cover	
		-Deck framing ok to cover		
Corrective Action Required:				

-Behind tubs and showers ok to cover

-Deck framing ok to cover

Corrective Action Required:

THIRD FLOOR

7 FOURTH FLOOR \*Building F

\*Building F

- -Behind tubs and showers ok to cover
- -Deck framing ok to cover

448-add stud at corridor and bathroom at bearing walls

449-add stud at corridor, install stud shoe at party wall, missing truss hanger

at kitchen, correct hanger at entry

447-correct hanger at entry, strap top plate at party wall

446-strap top plate at corridor, install stud at exterior corner, nail per code

445-Provide truss hold down at entry

444-ok

443-install stud shoe at bathroom

442-strap top plate at party walls, fireblock dead space at party walls

441-strap top plate at party walls 440-fireblock party wall, nail corners 439-missing h2.5 at entry, nail stud

438-missing h2.5 at entry

Corrective Action Required:

8 ELEVATOR 1 Interior framing ok all floors

## **Comments:**