CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 **DEVSERVICES.CITYOFLS.NET**

Inspection Summary

Permit #: PRRES20241045 Address: 1433 SW WINTHROP TER, LEES SUMMIT, MO 640811431 SW WINTHROP TER, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

| Inspection: All Rough Inspection - Residential | | Inspector: | Outcome: | Date: | |
|--|---|---|--------------------------------------|-------------------------------|--|
| | | Kyle Beard | Not Ready | Tuesday, October 08, 2024 | |
| Correct | tive Action Required: | | | | |
| 1 | Miscellaneous Correction | 1431 and 1433 SW W | 1431 and 1433 SW Winthrop. All rough | | |
| | | 1433 -Nail inside corner of entry to garage to code -Double LVL in entry on north side needs another stud under it for proper | | | |
| | | | | | |
| | | | | | |
| | | | load transfer (only one stud now) | | |
| | | | Nail corners of bedroom 2 to code | | |
| | | - | Secure gas line at fire place | | |
| | | -Check angle of LIB in master bedroom | | | |
| | | • | - | room for 4 feet on center | |
| | | -Anchor bolts in sole plate next to overhead garage door needs to be locate in the middle 1/3 of plate | | | |
| | | -Steel Ibeam in base inches of concrete f | _ | s not sit on the required 3 | |
| | -Fire block top plate at the end of the hallwa 3 | | | / between storage and bedroom | |
| | | -Vertically fire block basement walls every 10 feet on center | | | |
| | | Fire blocking was not completed in the basement and inspection was stopped | | | |
| | | | | | |

This is not a complete

Not ready for inspection

Comments: