## CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

## **DEVSERVICES.CITYOFLS.NET**

## **Inspection Summary**

Permit #: PRRES20242945

Address: 3718 SW KNOXVILLE CT, LEES SUMMIT, MO 640823716 SW KNOXVILLE CT, LEES SUMMIT, MO

64082

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Outcome: Date:

All Rough Inspection - Kyle Beard Failed Friday, November 08,

Residential 2024

Corrective Action Required:

2 Miscellaneous 3716 and 3718 SW Knoxville. All rough

Correction

3716

Garage anchor bolts needs to be located in the middle 1/3 of bottom plate

Tightened down PFH anchor bolts

Garage anchor bolts must be between 4-12 inches from bottom plate ends Provide missing fire blocking at overhead garage door for cantilevered floor

trusses

Fire blocking is broken out over garage Ibeam

Holes are closer than 2 inches together at electrical in PFH north side leg Vertical fire blocking is missing for 1/2 of king stud in garage at demising wall

Seal gaps in fire blocking above entry door Electrical nail guards are needed in the pantry Provide blocking for snow flashing at gable end

Fire rated roof sheathing at the ridge can have more than 1/4 of an inch gap

Gas gauge is at 0 PSI

3718

Garage anchor bolts need to be located in the middle 1/3 of bottom plate

Tightened down PFH anchor bolts

Install missing cantilever fire blocking above garage overhead door
Repair LIB in garage by overhead door
Seal top of garage chase at plumbing lines for fire blocking
Hole in vertical fire blocking in great room at demising wall
Provide blocking for snow flashing at gable end
Provide more fire caulking around electrical service wire at demising wall for proper coverage and around electrical bonding wire

## **Comments:**