CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 **DEVSERVICES.CITYOFLS.NET**

Inspection Summary

Permit #:PRRES20240700Address:207 NW ORCHARD CT, LEES SUMMIT, MO 64063205 NW ORCHARD CT, LEES SUMMIT, MO 64063

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: All Rough Inspection - Residential		Inspector:	Outcome:	Date:
		Robb Popp	Failed	Tuesday, December 10, 2024
Correcti	ive Action Required	:		
1	Misc	Unit 205:		
		-Protect water lines -Fb basement wall f -Provide stud shoes 60%-Use proper nai -Egress windows in -Complete DWV in l -Engineer to provid wall PFH locations	Fb duct chase from soffit and joist space-seal gaps and penetrations Protect water lines at master bathroom shower-DWV outside of shower wall Fb basement wall from all soffits-seal gaps Provide stud shoes for basement non-bearing wall studs bored more than 50%-Use proper nails Egress windows in 2nd floor above 44"-must comply with R310 Complete DWV in basement Engineer to provide specs for hold down devices used as alternative on back wall PFH locations	
		Unit 207:		
		space; take care of t and penetrations -Fb duct chase from	-Provide 5/8" type X rock at fire separation wall inside duct chases and soffit space; take care of the rated wall before all-rough can be approved-Seal gaps and penetrations -Fb duct chase from soffit and joist space-Seal gaps -Install stud shoe at laundry wall where bored more than 60%-Use proper	

fasteners

-Provide wall receptacle at master bedroom wall exceeding 2 ft-seal penetrations

-Protect dryer duct min 2" below plate line

-Fb basement wall from all soffits-Seal gaps

-Provide stud shoes for basement non-bearing wall studs bored more than 60%-Use nails

-Provide 5/8" type X rock at fire separation wall at back of furnace

-Engineer to provide specs for hold down devices used as alternative on back wall PFH locations

-Egress windows in 2nd floor above 44"-must comply with R310

Comments: