CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 **DEVSERVICES.CITYOFLS.NET**

Inspection Summary

Permit #: PRCOM20240118 Address: 515 NW MOORE ST, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
All Rough Inspection - Commercial	Robb Popp	Partial	Tuesday, January 07, 2025
Corrective Action Required: 1 FIRST FLOOR Corrective Action Required: 2 SECOND FLOOR Corrective Action Required: 3 THIRD FLOOR	Corridor ceiling framing Corridor ceiling framing Partial all rough for unit Throughout; -Install all fire dampers -Complete balcony fram -Seal dead spaces and ir -Seal penetrations at co Partial only: 335-Patch rock at corrido at shower, Fire block top corners, strap corners no	e for electrical equipment approved approved s only. Balconies and other hing histall collars	seal top plate penetration ing trap for tub above, nail seal bottom plate at

Corrective Action Required: 4 FOURTH FLOOR	at bed 2 top plate, seal top plate at bed 2 334-Patch rock behind tub stud to stud, over bored studs at bathroom, strap corners, label white conductor as current carrying, support/ secure SER at draft stop, missing trap for shower above 333-FB ceiling line and strap corners at living, protect nm above balcony door, missing trap, secure SER at draft stop, protect nm at entry door
	Corridor ceiling framing approved
	Partial all rough for units only. Balconies and other spaces not complete
	Throughout;
	-Install all fire dampers -Complete balcony framing -Seal dead spaces and install collars -Install putty packs at party walls
	In addition to throughout items typical of all 432- seal penetrations in dead space fire blocking 421- fire caulk sprinkler line at party wall 412-fireblock top of furr out wall, Fireblock vertical at 10' oc max at shaft wall (seal penetrations), complete atrium shaft wall, missing stud at furr out wall *OK TO INSULATE-DO NOT COVER INSPECTION ITEMS

Comments: