CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 **DEVSERVICES.CITYOFLS.NET**

Inspection Summary

Permit #:PRRES20241493Address:2120 NW OBRIEN RD, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
All Rough Inspection - Residential	Shawn Hoffman	Failed	Wednesday, January 29, 2025
Informational: 1 Misc Corrective Action Required: 2 Misc	 Anchor bolts to be in mide Hold down strap on port Purlin struts to be 4' OC f Valleys rafters not support Provide straps on load be Add studs to 14" LVL abor prep kitchen Repair top plate at hallw Strap top plate in master wall Unable to inspect framin Provide post caps or othe No suspended slab inspect 	ce in hearth room blates on bearing wall at lau ddle third of sill plate at gar al frame missing on double throughout bsed at ridge in garage earing wall with over board ve top plate to carry loads a ay entrance to mast suite bathroom vanity wall were g of porch or deck cover (co er means to secure the 2 pa	for DWV in prep kitchen as below at kitchen/ e over bored on bearing overed) rt 6x6 post at deck beam
	 Vent basement laundry Fire block top of dead sp 		

- Minimum of 3 studs on all exterior corners in bedroom 2 return wall not full length stud

- Anchor steel columns throughout

_

- Fire block chase in bedroom 4 closet at top plate

- Fire block top of chase at shower between bedroom 3/4

- Replace vertical fire blocking in basement bedrooms with approved material

Comments: