CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRRES20240701

Address: 213 NW ORCHARD CT, LEES SUMMIT, MO 64063211 NW ORCHARD CT, LEES SUMMIT, MO 64063

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

Rated Assembly Inspection Mitchell Schwarz Not Ready Thursday, March 06,

2025

Corrective Action Required:

1 Misc -Inspection for firewall "pre rock" only:

- ***MECHANICAL AT 2ND FLOOR INSTALLED BEFORE WALLS APPROVED IN CHASES
- *Unit 211
- -Nail intersecting studs 12" oc at first and second floor (studs to exterior wall)
- -Seal top plate penetration at garage door lv wire
- -Fireblock gap at top of double wall at first and second floor-SEAL ALL GAPS
- -Protect all penetrations (electrical boxes and fridge water supply box) per R302.4.2
- -Drywall installed in mechanical chase on 2nd floor is not approved-LARGE HOLES IN ROCK, SHORT OF TOP PLATES, NOT BREAKING ON A STUD, NOT SECURED AT EDGES, NOT CONTINIOUS BEHIND INTERSECTING WALLS
- *Unit 213
- -Nail intersecting studs 12" oc at first and second floor (studs to exterior wall)
- -Seal top plate penetration at garage door ly wire
- -Fireblock gap at top of double wall at first and second floor-SEAL ALL GAPS
- -Protect all penetrations (electrical boxes and fridge water supply box) per R302.4.2
- -Drywall installed in mechanical chase on 2nd floor is not approved-LARGE

HOLES IN ROCK, SHORT OF TOP PLATES, NOT BREAKING ON A STUD, NOT SECURED AT EDGES, NOT CONTINIOUS BEHIND INTERSECTING WALLS

Corrective Action Required:

2 Misc 2/12/25

Inspection for mechanical chase at 1st floor only -Fire tape approved-OK TO REINSTALL HVAC

Corrective Action Required:

3 Misc Multiple items not address. No city stamped plans on site.

Comments: