

CITY OF LEE'S SUMMIT  
Development Services Department  
220 SE Green Street  
Lee's Summit, MO 64063  
(816)969-1200  
**DEVSERVICES.CITYOFLS.NET**

## Inspection Summary

Permit #: PRRES20240701

Address: 213 NW ORCHARD CT, LEES SUMMIT, MO 64063 211 NW ORCHARD CT, LEES SUMMIT, MO 64063

---

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
<b>Rated Assembly Inspection</b>	Robb Popp	Not Ready	Thursday, March 13, 2025

Corrective Action Required:

1 Misc

3/13/25

-Inspection for firewall "pre rock" only:

\*\*\*MECHANICAL AT 2ND FLOOR INSTALLED BEFORE WALLS APPROVED IN CHASES

\*Unit 211

-Nail intersecting studs 12" oc at first and second floor (studs to exterior wall)

-Seal top plate penetration at garage door lv wire

-Fireblock gap at top of double wall at first and second floor-SEAL ALL

GAPS-SMART TRIM AND SMART SIDING ARE NOT APPROVED FIREBLOCKING MATERIALS

-Protect all penetrations (electrical boxes and fridge water supply box) per R302.4.2

-Drywall installed in mechanical chase on 2nd floor is not approved-LARGE HOLES IN ROCK, SHORT OF TOP PLATES, NOT BREAKING ON A STUD, NOT SECURED AT EDGES, NOT CONTINUOUS BEHIND INTERSECTING WALLS

\*Unit 213

-Nail intersecting studs 12" oc at first and second floor (studs to exterior wall)

-Fireblock gap at top of double wall at first and second floor-SEAL ALL

GAPS-SMART TRIM AND SMART SIDING ARE NOT APPROVED FIREBLOCKING

MATERIALS

-Protect all penetrations (electrical boxes and fridge water supply box) per R302.4.2

-Drywall installed in mechanical chase on 2nd floor is not approved-LARGE HOLES IN ROCK, SHORT OF TOP PLATES, NOT SECURED AT EDGES, NOT CONTINUOUS BEHIND INTERSECTING WALLS

**Comments:**