CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 **DEVSERVICES.CITYOFLS.NET**

Inspection Summary

Permit #:PRRES20245645Address:2082 NW OBRIEN RD, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: All Rough Inspection - Residential		Inspector:	Outcome:	Date:	
		Robb Popp	Failed	Tuesday, April 08, 2025	
Inform	ational:				
1	Misc	Inspection for PFH, front porch ceiling and covered deck ceiling: -PFH, front porch and deck ok to cover			
Correct	ive Action Required:				
2	Miscellaneous Correction	House is not ready inspection, there are too many deficiencies to perform inspection. Inspection is incomplete and list is subject to change. Correct the following items before rescheduling:			
		-Nail exterior comers per code			
		-Nail top plate to PFH header 3" oc with 2 rows 16d sinkers			
		-	-Install missing nails at PFH straps -Tighten anchor bolts throughout		
		•	not breaking on studs at	2 car bay	
		-Nail ceiling joists to	-		
		•••	in middle third of plate	at garage	
	-Install missing bits at a				
		-Install second anch	or bolt at column basepl	ate in garage	
			oped less than 24" by bea		
			er notched for DWV by b		
		 Studs spaced beyo 	nd 16″ oc at 2 car bay wal	l	

-Nail lapped ceiling joists per code

-Nail multi ply stud and joist packs per code

-Provide proper slope on DWV in attic space

-Complete all fireblocking at dead spaces, at soffit and ceiling lines, seal all top plate penetrations etc

-Fireblock top of fireplace-Use approved materials and seal gaps

-Use proper materials for fireblocking throughout. $1/2^{\prime\prime}$ sheathing is not approved material

Comments: