# CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063

(816)969-1200

# **DEVSERVICES.CITYOFLS.NET**

# **Inspection Summary**

Permit #: PRCOM20235207

Address: 2931 SE SHENANDOAH DR, LEES SUMMIT, MO 64063

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Outcome: Date:

All Rough Inspection - Khanh Nguyen Failed Thursday, May 22,

Commercial 2025

Corrective Action Required:

1 Misc Front garage PFH walls only:

-Provide 2 anchors per wall sill plate

-Nail wall top plate to header w/ 2 rows of 16d @ 3" oc

Corrective Action Required:

2 Misc Interior and exterior sheathed shearwalls:

-lower level, 1st, and 2nd fl-one side sheathed

-exterior shearwalls

Corrective Action Required:

3 LOWER LEVEL -Pre-rock behind tubs ad showers

Corrective Action Required:

4 FIRST FLOOR -Pre-rock behind tubs ad showers

Corrective Action Required:

5 SECOND FLOOR -Pre-rock behind tubs ad showers

Corrective Action Required:

6 THIRD FLOOR \*\*Check all units

-Secure wiring within 12" of ceiling boxes

-Protect all back-back boxes

-Fire stop all plumbing penetrations of floor per Hilti

-Fire caulk all penetrations of corridor rim; all wall plate penetrations

-Remove insulation from corridor walls

-Nail together stud pack per plan

- -3 stud support for balcony beam
- -Screw studs adjacent to floor-floor screws per plan
- -Access to roof space above end units
- -Frame the cantilevered balcony roof per 2/S3.42
- -1st layer inside ceiling space at stair tower wall needs more work

#### 318:

- -Fc gap at dead space by tub; wall plate penetration
- -Secure wiring within 12" of panel; light above master closet
- -Floor-floor screws at exterior wall

#### 317:

-Close gap at top of double stud wall

#### 315:

-Fc gap at dead space by tub; wall plate penetration

#### 313:

- -Stud support under balcony beam
- -Fc plumbing penetration of wall and floor at tub and above laundry; media wall top plates

#### 316:

-Close/fc gap at all double stud wall spaces Protect electrical boxes

#### 314:

-Install collar for 6" roof drain

#### 311:

-Fc holes at top of laundry wall; Fc at bottom plate at tub

#### 312:

-Secure kitchen range and ceiling light cables within 12" of box

## 309:

- -Fc penetrations of corridor rim
- -Support dryer duct above rear master bedroom wall
- -Close gap at top of double stud wall
- -Protect wiring below panel

#### 310:

- -Provide a receptacle at panel wall space
- -Complete fur out at 6" roof drain

#### 307:

- -Patch hole behind dryer
- -Fc penetration of elevator firewall

## 308:

_	_	_	
2	n	_	٠

-Provide a receptacle at panel wall space

306:

304:

## 303:

-Gypsum at top lid of space adjacent to tub

#### 302:

- -Fc top lid of space adjacent to shower
- -Install media box
- -Tie down trusses to balcony beam; tie down beam
- -Provide fire GB at stair tower

#### 301:

- -Fc top lid of space adjacent to shower
- -Install media box
- -Tie down trusses to balcony beam; tie down beam

# Corrective Action Required:

7 FOURTH FLOOR

Dwelling units only:

- -Draft-stop holes and gap between draftstops 7&8
- -Install firestop at roof drain floor&ceiling penetrations per Hilti Instructions (403, 404, 411, 412)

#### **Comments:**

<sup>\*\*</sup>Area outsie dwelling units not yet inspected