CITY OF LEE'S SUMMIT

Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

OnlinePortal at DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRCOM20235207

Address: 2931 SE SHENANDOAH DR, LEES SUMMIT, MO 64063

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

All Rough Inspection - Khanh Nguyen Partial Monday, June 09, 2025

Commercial

Corrective Action Required:

1 Misc Front garage PFH walls only:

-Provide 2 anchors per wall sill plate

-Nail wall top plate to header w/ 2 rows of 16d @ 3" oc

Corrective Action Required:

2 Misc Interior and exterior sheathed shearwalls:

-lower level, 1st, and 2nd fl-one side sheathed

-exterior shearwalls

Corrective Action Required:

3 LOWER LEVEL OK:

-Pre-rock behind tubs and showers

Demising/shearwall in-wall correction:

-Vent cloth washer trap (006)

Corrective Action Required:

4 FIRST FLOOR OK:

-Pre-rock behind tubs ad showers

Demising/shearwall in-wall corrections:

-FB gap at top plates (101) -Anchor sill plates (110)

Corrective Action Required:

5 SECOND FLOOR OK:

-Pre-rock behind tubs ad showers

-Demising/shearwall in-wall

Corrective Action Required:

6 THIRD FLOOR

**Check all units

-Fire stop all plumbing penetrations of floor per Hilti

-Access to roof space above end units

-Frame the cantilevered balcony roof per 2/S3.42

-1st layer inside ceiling space at stair tower wall needs more work -Check around elevator wall and fc all membrane penetration

310:

-Complete fur out at 6" roof drain

302:

-Tie down trusses to balcony beam; tie down beam

301:

-Tie down trusses to balcony beam; tie down beam

Corridor:

-Secure EM light wiring at max 4.5 ft intervals

Corrective Action Required:

7 FOURTH FLOOR Dwelling units-OK

Corridor- OK

Comments: