

CITY OF LEE'S SUMMIT
Development Services Department
220 SE Green Street
Lee's Summit, MO 64063
(816)969-1200
OnlinePortal at DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRCOM20235207
Address: 2931 SE SHENANDOAH DR, LEES SUMMIT, MO 64063

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
All Rough Inspection - Commercial	Khanh Nguyen	Partial	Tuesday, June 10, 2025

Corrective Action Required:

1	Misc	Front garage PFH walls only: -Provide 2 anchors per wall sill plate -Nail wall top plate to header w/ 2 rows of 16d @ 3" oc
---	------	---

Corrective Action Required:

2	Misc	Interior and exterior sheathed shearwalls: -lower level, 1st, and 2nd fl-one side sheathed -exterior shearwalls
---	------	---

Corrective Action Required:

3	LOWER LEVEL	OK: -Pre-rock behind tubs and showers
---	-------------	--

Demising/shearwall in-wall correction:
-Vent cloth washer trap (006)

Corrective Action Required:

4	FIRST FLOOR	OK: -Pre-rock behind tubs ad showers
---	-------------	---

Demising/shearwall in-wall corrections:
-FB gap at top plates (101)
-Anchor sill plates (110)

Corrective Action Required:

5	SECOND FLOOR	OK: -Pre-rock behind tubs ad showers -Demising/shearwall in-wall
Corrective Action Required:		
6	THIRD FLOOR	-Access to roof space above end units -Frame the cantilevered balcony roof per 2/S3.42 -1st layer inside ceiling space at stair towers wall needs more work. Add blockings where required and nail GB 302: -Tie down trusses to balcony beam; tie down beam 301: -Tie down trusses to balcony beam; tie down beam Corridor: -Secure EM light wiring at max 4.5 ft intervals
Corrective Action Required:		
7	FOURTH FLOOR	Dwelling units-OK Corridor- OK

Comments: