


1304 Northeast Goshen Drive, Lee's Summit, MO 64064

Report: 67520009

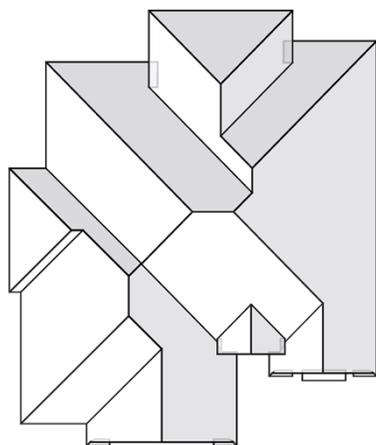

In this 3D model, facets appear as semi-transparent to reveal overhangs.

PREPARED FOR

Contact:	Ozzie Martinez
Company:	3MG Solutions, LLC
Address:	1850 W Fairbanks Ave Ste B Winter Park, FL 32789-4559
Phone:	407-420-0201

TABLE OF CONTENTS

Images	1
Length Diagram	4
Pitch Diagram	5
Area Diagram	6
Notes Diagram.....	7
Penetrations Diagram.....	8
Report Summary.....	9

MEASUREMENTS

Total Roof Area =3,736 sq ft
 Total Roof Facets =25
 Predominant Pitch =8/12
 Number of Stories >1
 Total Ridges/Hips =286 ft
 Total Valleys =146 ft
 Total Rakes =66 ft
 Total Eaves =244 ft
 Estimated Attic=3,116 sq ft
 Total Penetrations =15
 Total Penetrations Perimeter = 56 ft
 Total Penetrations Area = 14 sq ft

Measurements provided by www.eagleview.com



Certified Accurate

www.eagleview.com/Guarantee.aspx


1304 Northeast Goshen Drive, Lee's Summit, MO 64064

Report: 67520009

IMAGES

The following aerial images show different angles of this structure for your reference.

Top View

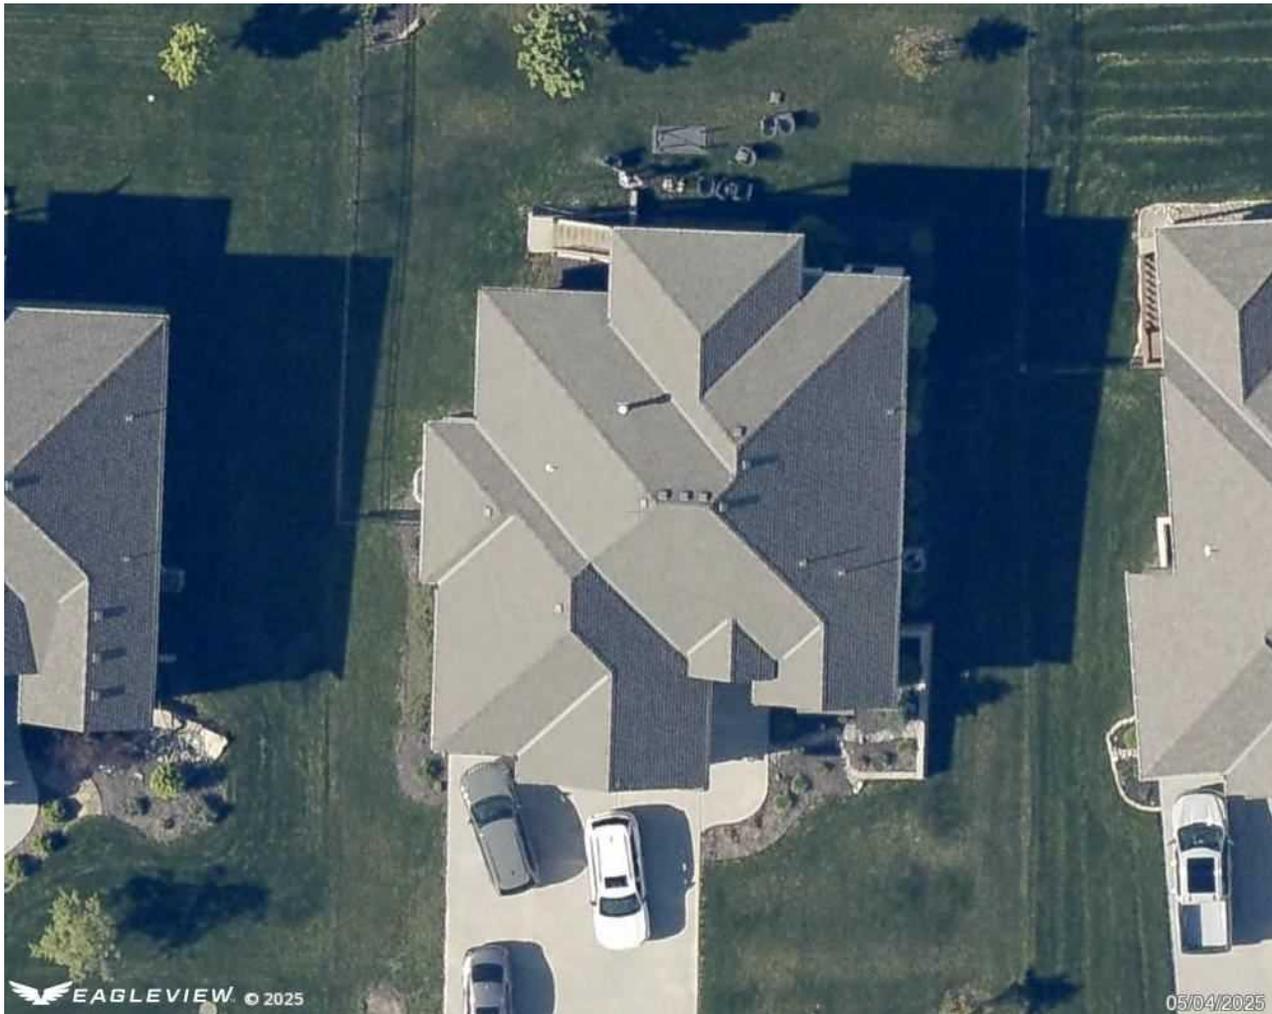


IMAGES

North Side



South Side

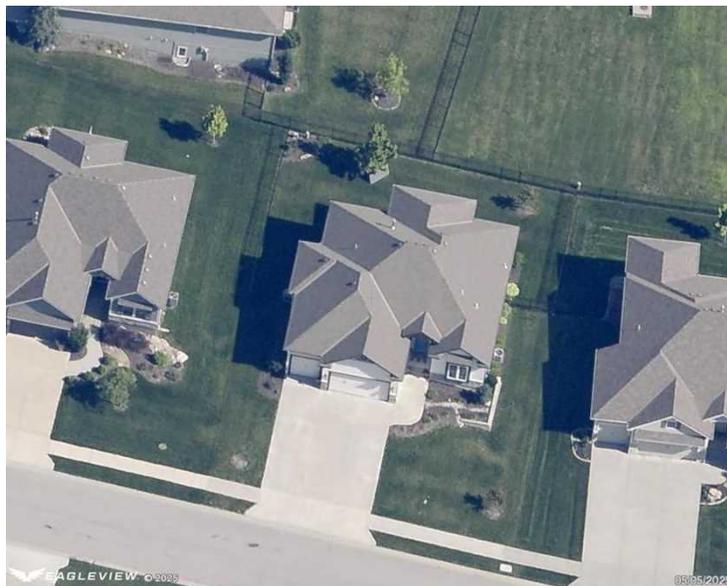


IMAGES

East Side



West Side

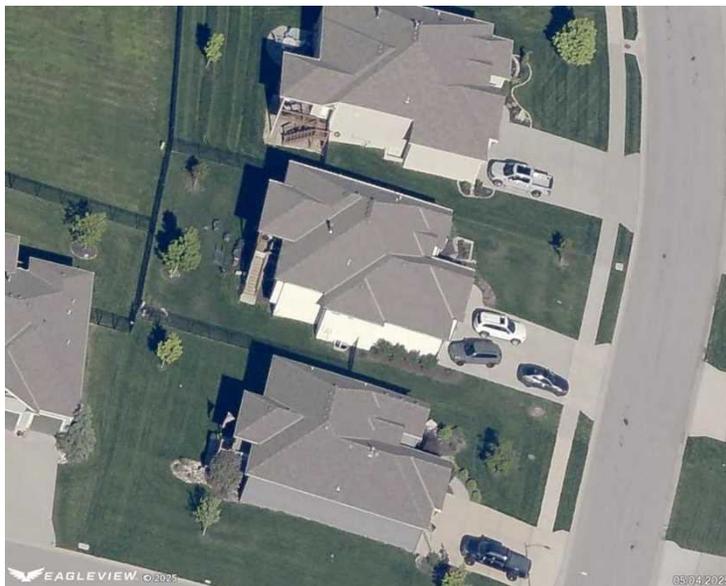


1304 Northeast Goshen Drive, Lee's Summit, MO 64064

Report: 67520009

PITCH DIAGRAM

Pitch values are shown in inches per foot, and arrows indicate slope direction. The predominant pitch on this roof is 8/12

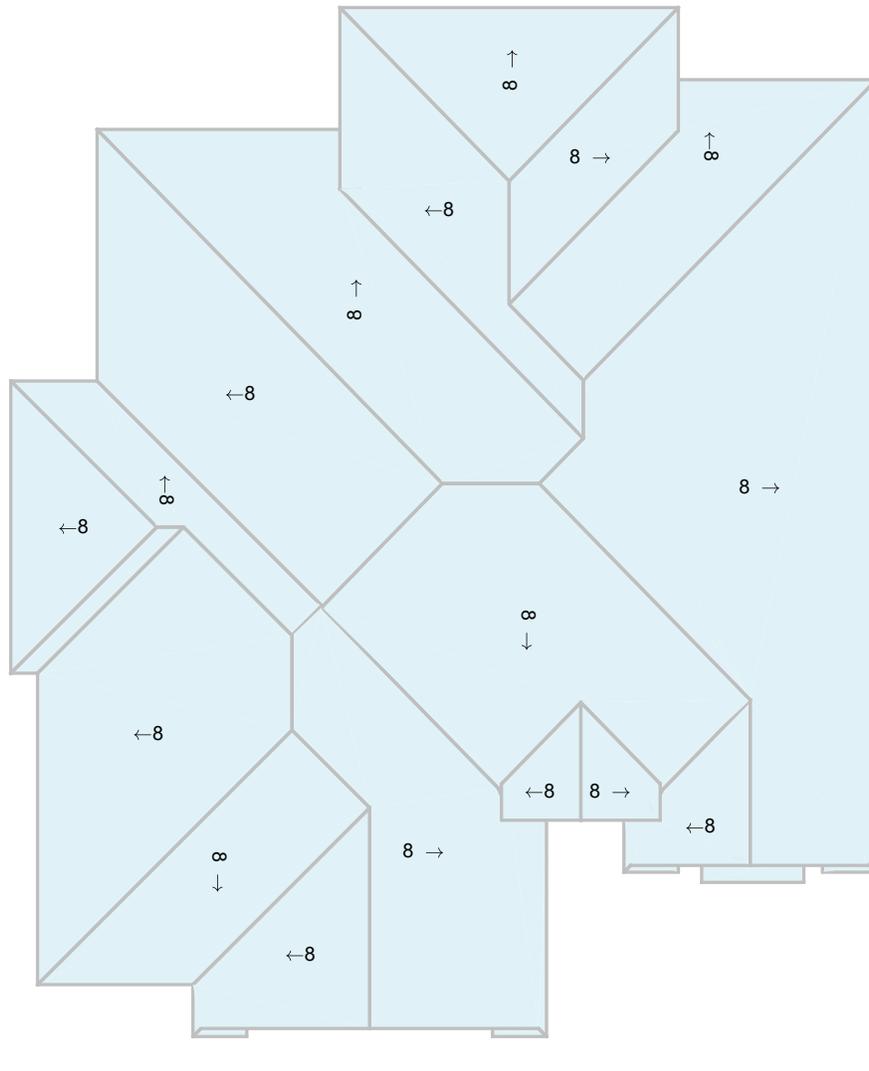

© 2025 Eagle View Technologies, Inc., All Rights Reserved.


Note: This diagram contains labeled pitches for facet areas larger than 20.0 square feet. In some cases, pitch labels have been removed for readability. Blue shading indicates a pitch of 3/12 and greater.

1304 Northeast Goshen Drive, Lee's Summit, MO 64064

Report: 67520009

AREA DIAGRAM

Total Area = 3,736 sq ft, with 25 facets.

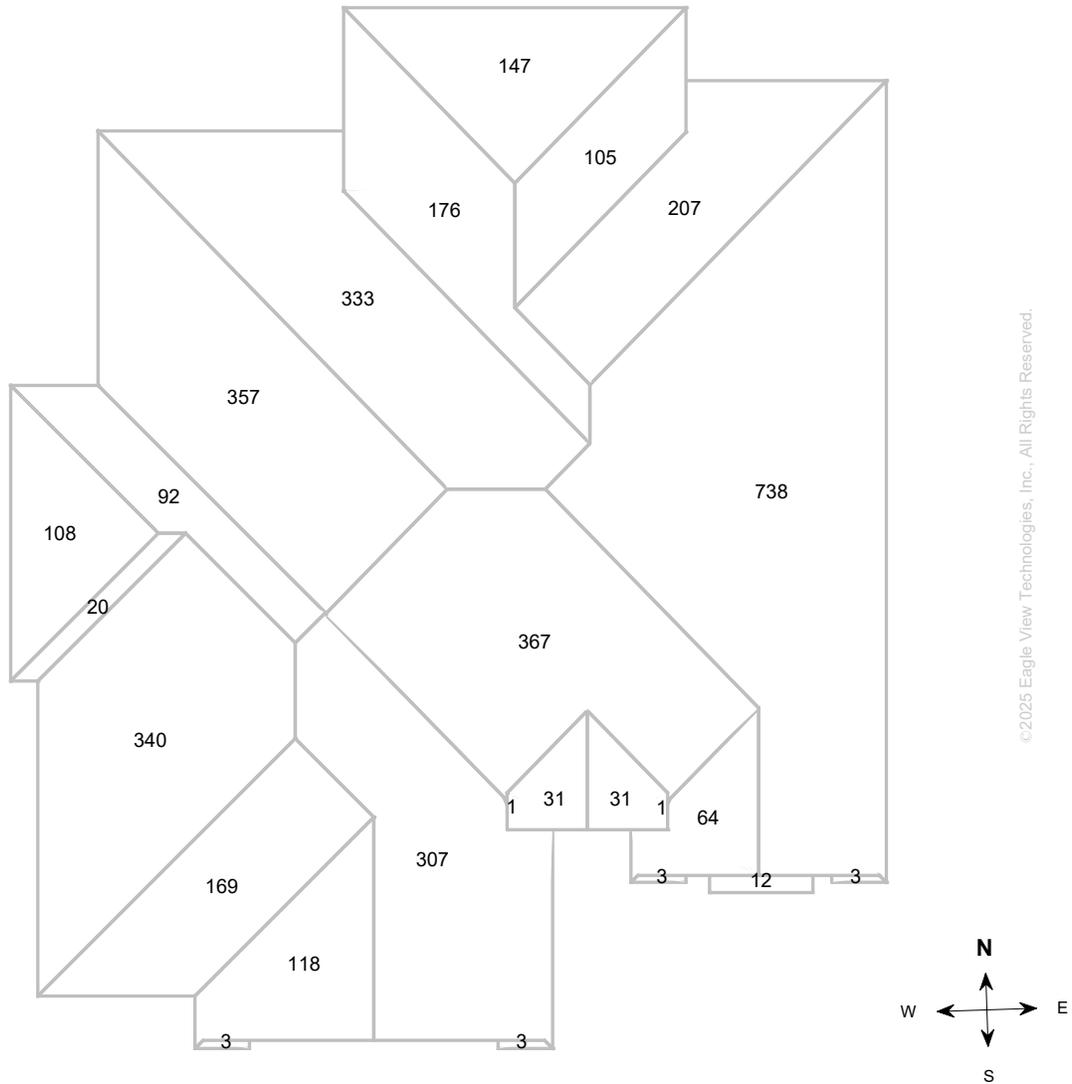


©2025 Eagle View Technologies, Inc., All Rights Reserved.

Note: This diagram shows the square feet of each roof facet (rounded to the nearest Foot). The total area in square feet, at the top of this page, is based on the non-rounded values of each roof facet (rounded to the nearest square foot after being totaled).

NOTES DIAGRAM

Roof facets are labeled from smallest to largest (A to Z) for easy reference.

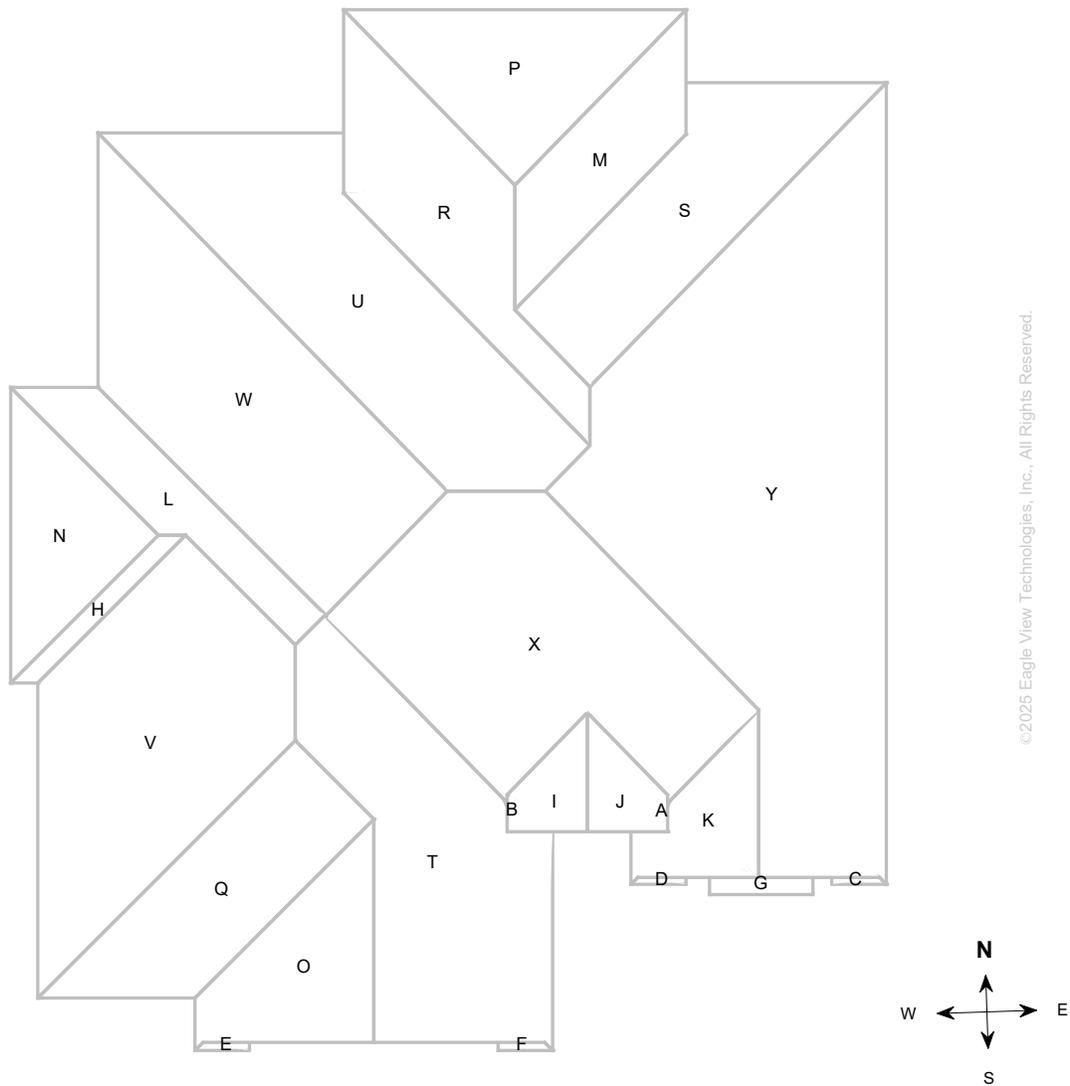

Note: This diagram also appears in the Property Owner Report.

PENETRATIONS NOTES DIAGRAM


Penetrations are labeled from smallest to largest for easy reference.

Total Penetrations = 15

Total Penetrations Perimeter = 56 ft

Total Penetrations Area = 14 sq ft

Total Roof Area Less Penetrations = 3,722 sq ft

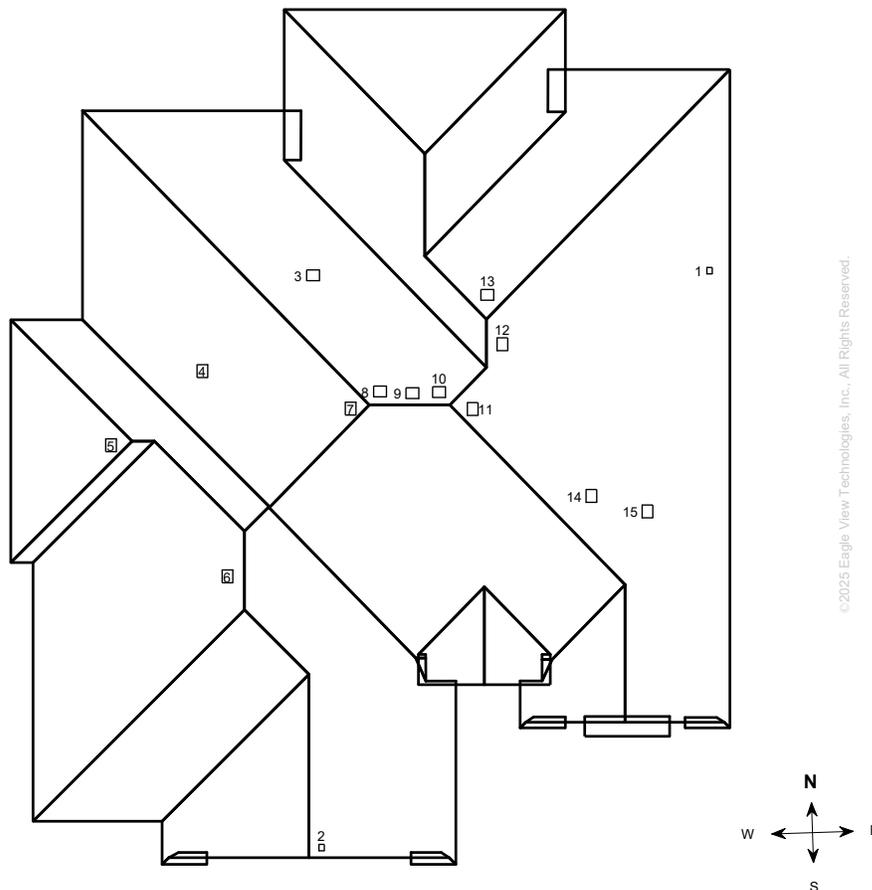

©2025 Eagle View Technologies, Inc., All Rights Reserved.

1304 Northeast Goshen Drive, Lee's Summit, MO 64064

Report: 67520009

REPORT SUMMARY

All Structures

Areas per Pitch		
Roof Pitches	4/12	8/12
Area (sq ft)	1.4	3734.3
% of Roof	0%	100%

The table above lists each pitch on this roof and the total area and percent (both rounded) of the roof with that pitch.

Structure Complexity		
Simple	Normal	Complex


Waste Calculation									
NOTE: This waste calculation table is for asphalt shingle roofing applications. All values in table below only include roof areas of 3/12 pitch or greater. For total measurements of all pitches, please refer to the Lengths, Areas, and Pitches section below.									
Waste %	0%	6%	11%	16%	19%	21%	23%	26%	31%
Area (Sq ft)	3736	3961	4147	4334	4446	4521	4596	4708	4895
Squares *	37.66	39.66	41.66	43.66	44.66	45.33	46.00	47.33	49.00
	Measured					Suggested			

* Squares are rounded up to the 1/3 of a square

Additional materials needed for ridge, hip, and starter lengths are not included in the above table. The provided suggested waste factor is intended to serve as a guide—actual waste percentages may differ based upon several variables that EagleView does not control. These waste factor variables include, but are not limited to, individual installation techniques, crew experiences, asphalt shingle material subtleties, and potential salvage from the site. Individual results may vary from the suggested waste factor that EagleView has provided. The suggested waste is not to replace or substitute for experience or judgment as to any given replacement or repair work.

Penetrations	1-2	3-15							
Area (sq ft)	0.2	1							
Perimeter (ft)	2	4							

Any measured penetration smaller than 3.0x3.0 Feet may need field verification. Accuracy is not guaranteed. The total penetration area is not subtracted from the total roof area.

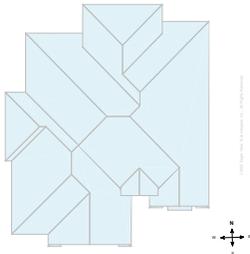1304 Northeast Goshen Drive, Lee's Summit, MO 64064
Report: 67520009
All Structures Totals

 Total Roof Facets = 25
 Total Penetrations = 15

Lengths, Areas and Pitches

 Ridges = 59 ft (9 Ridges)
 Hips = 227 ft (18 Hips).
 Valleys = 146 ft (11 Valleys)
 Rakes† = 66 ft (12 Rakes)
 Eaves/Starter‡ = 244 ft (22 Eaves)
 Drip Edge (Eaves + Rakes) = 310 ft (34 Lengths)
 Parapet Walls = 0 (0 Lengths).
 Flashing = 21 ft (9 Lengths)
 Step flashing = 22 ft (12 Lengths)
 Total Penetrations Area = 14 sq ft
 Total Roof Area Less Penetrations = 3,722 sq ft
 Total Penetrations Perimeter = 56 ft
 Predominant Pitch = 8/12
Total Area (All Pitches) = 3,736 sq ft
Property Location

 Longitude = -94.3471096
 Latitude = 38.9974810

Notes

This was ordered as a residential property. There were no changes to the structure in the past four years.

Online Maps

Online map of property

http://maps.google.com/maps?f=q&source=s_q&hl=en&geocode=&q=1304+Northeast+Goshen+Drive,Lee's+Summit,MO,64064

Directions from 3MG Solutions, LLC to this property

http://maps.google.com/maps?f=d&source=s_d&saddr=1850+W+Fairbanks+Ave+Ste+B,Winter+Park,FL,32789-4559&daddr=1304+Northeast+Goshen+Drive,Lee's+Summit,MO,64064

† Rakes are defined as roof edges that are sloped (not level).

‡ Eaves are defined as roof edges that are not sloped and level.

1304 Northeast Goshen Drive, Lee's Summit, MO 64064

Report: 67520009

IMPORTANT LEGAL NOTICE AND DISCLAIMER**Notice and Disclaimer**

No Warranty: The Copyrighted Materials are provided to you "as is," and you agree to use it at your own risk.

EagleView Technologies makes no guarantees, representations or warranties of any kind, express or implied, arising by law or otherwise, including but not limited to, content, quality, accuracy, completeness, effectiveness, reliability, fitness for a particular purpose, usefulness, use or results to be obtained from the Copyrighted Materials.

Contractors agree to always conduct a preliminary site survey to verify Roof Report ordered. In the event of an error in a Report, your sole remedy will be a refund of the fees paid by you to obtain this Report.