

*David P. Ainsworth, P.E.*  
*1200 NW Hearnese Ave, Blue Springs, MO 64015*  
*Cell Phone: 816-682-2093*  
*Email: [dainsworth@chelepis.com](mailto:dainsworth@chelepis.com)*

October 16, 2023

Mr. Bill Wilson  
M. L. Crose Foundations  
4512 N Allison Rd  
Sibley, MO 64088

Re: 2206 SW Red Barn Ln  
Lee's Summit, MO  
Hook Farms Lot 56  
Damaged Concrete @ Garage Door Inspection

Dear Mr. Wilson:

On October 3, 2023, I inspected the damaged concrete at the garage door opening at the above referenced property. When backfilling the garage area the equipment operator hit the lower right hand corner and broke a chunk of concrete off.

To repair this damage you should saw cut the sections out and pin #4 rebar into existing form and pour back in accordance with the attached sketches. This repair will provide adequate support for the damaged corner.

Cordially,


*David P. Ainsworth, P.E.*

David P. Ainsworth, P.E.



*David P. Ainsworth*  
10-16-23


BROKE WALL

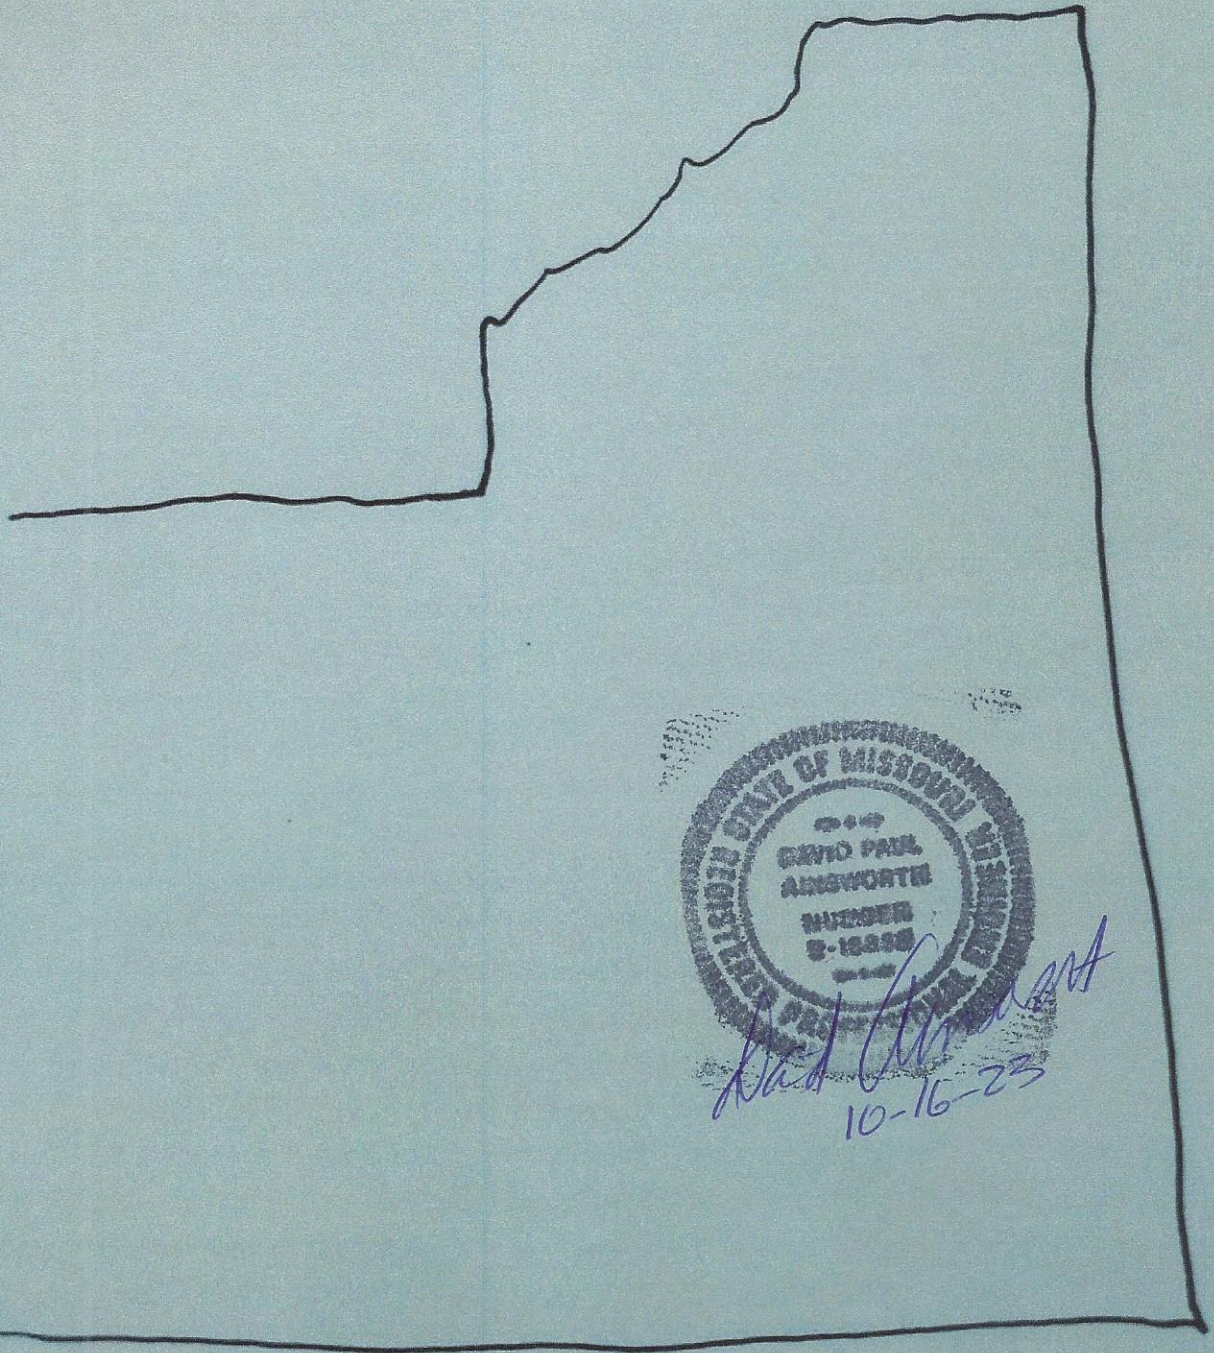

Repair

NEW  
Wind Strap

SAW CUT WALL

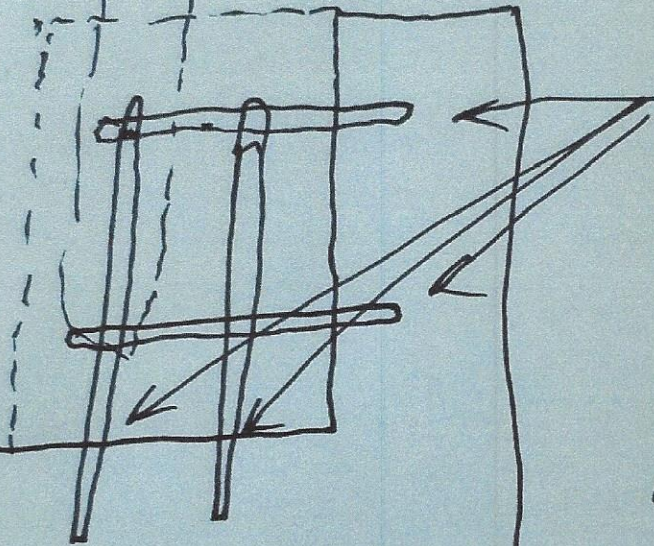


Drill & EPOXY

# 4 Rebar

2 - VERT

2 - HORZ

INSTALL NEW  
Wind Strap

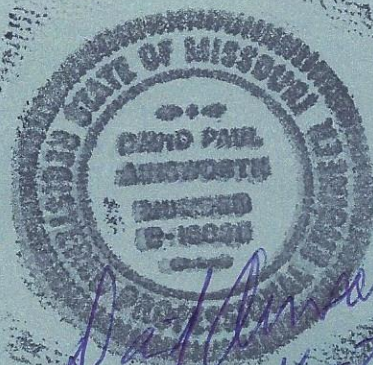

*D. J. [Signature]*  
10-16-23