

June 27, 2023

Mr. David Olson
Streets of West Pryor, LLC
7200 W 132nd Street, #150
Overland Park, Kansas 66213

Re: Long-Term Monitoring Plan Survey Points
Lots 7A (Area A), 7B (Area C), and 7C (Area B)
Mine Remediation at Streets of West Pryor
Lee's Summit, Missouri

Dear Mr. Olson,

This document serves to convey the results of the settlement monitoring that was conducted on the Streets West of Pryor project for the month of June 2024. This report has been updated with information provided by the surveyor, which has been documented in Figure 2. During this monitoring period, potential ground movements were monitored using a combination of surface monitoring points (SMPs) and survey points that were established on sanitary and storm sewer inlets and/or manholes. Surveys of SMPs were performed by BHC, Inc. SMPs C107 and C109 were unable to be surveyed – no notes from the Surveyor were provided to account for these SMP's not being observed.

Table 1 and graphic plots show the updated data for SMPs. The current survey readings were obtained on June 03, 2024, in general accordance with the Long-Term Monitoring Plan (LTMP). Table 1 documents the monitoring events to date and Exhibit 1 presents the graphic plots that depict the data obtained in relation to elapsed time. The installations of the sleeved rod monuments have been completed, and elevation data recorded.

Based on the current set of data and field observations, one SMP C110 has exceeded the limits of 0.08ft established in the LTMP. SMP C110 has been out of tolerance since the BHC's observation on 05 January 2023. Since this initial reading beyond tolerance, C110 has only varied ~0.01ft from observation to observation up to the most recent survey. Without knowing the field conditions, this appears to be a human intervention possibly with movement of heavy equipment or initial settling – since 05 January 2023 SMP C110 appears to have stabilized.

Figure 1	-	Monitoring Plan Locations
Figure 2	-	Monitoring Results from BHC
Table 1	-	Monitoring Point Displacement Summary
Exhibit 1	-	Monitoring Point Graphic Plots

* * * * *

If you have a question regarding this letter, or if we may be of additional service to you, please contact the undersigned.

Sincerely,

Construction Resource Management, LLC.



Kyle Rowden, P.G., Remote Pilot
Chief Geologist/Technical Services Director
C: 307.213.0477 / www.crm-ar.com





Kyle W. Rowden

27 June 2024

I:\028440 Streets of West Pryor Mine Scan\DWG\Survey\028440-SR01-MONITOR-EXHIBIT_PROP_LTM.dwg
Dec 06, 2022 - 1:16pm Plotted by: matthew.schepmann

STREETS OF WEST PRYOR LONG TERM MONITORING LOCATION EXHIBIT

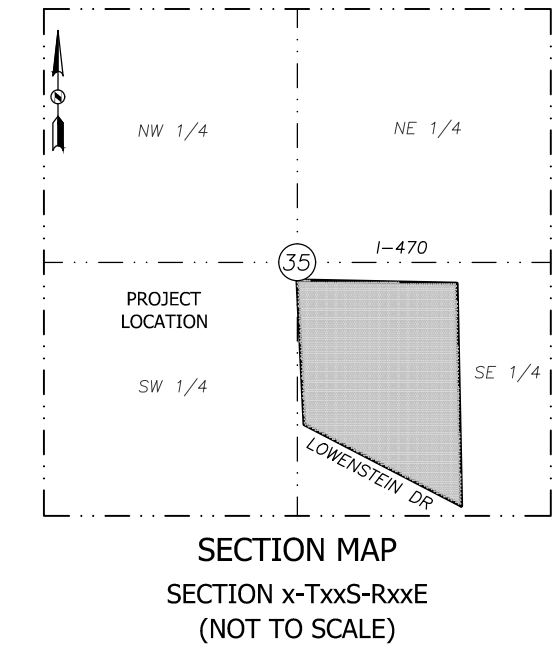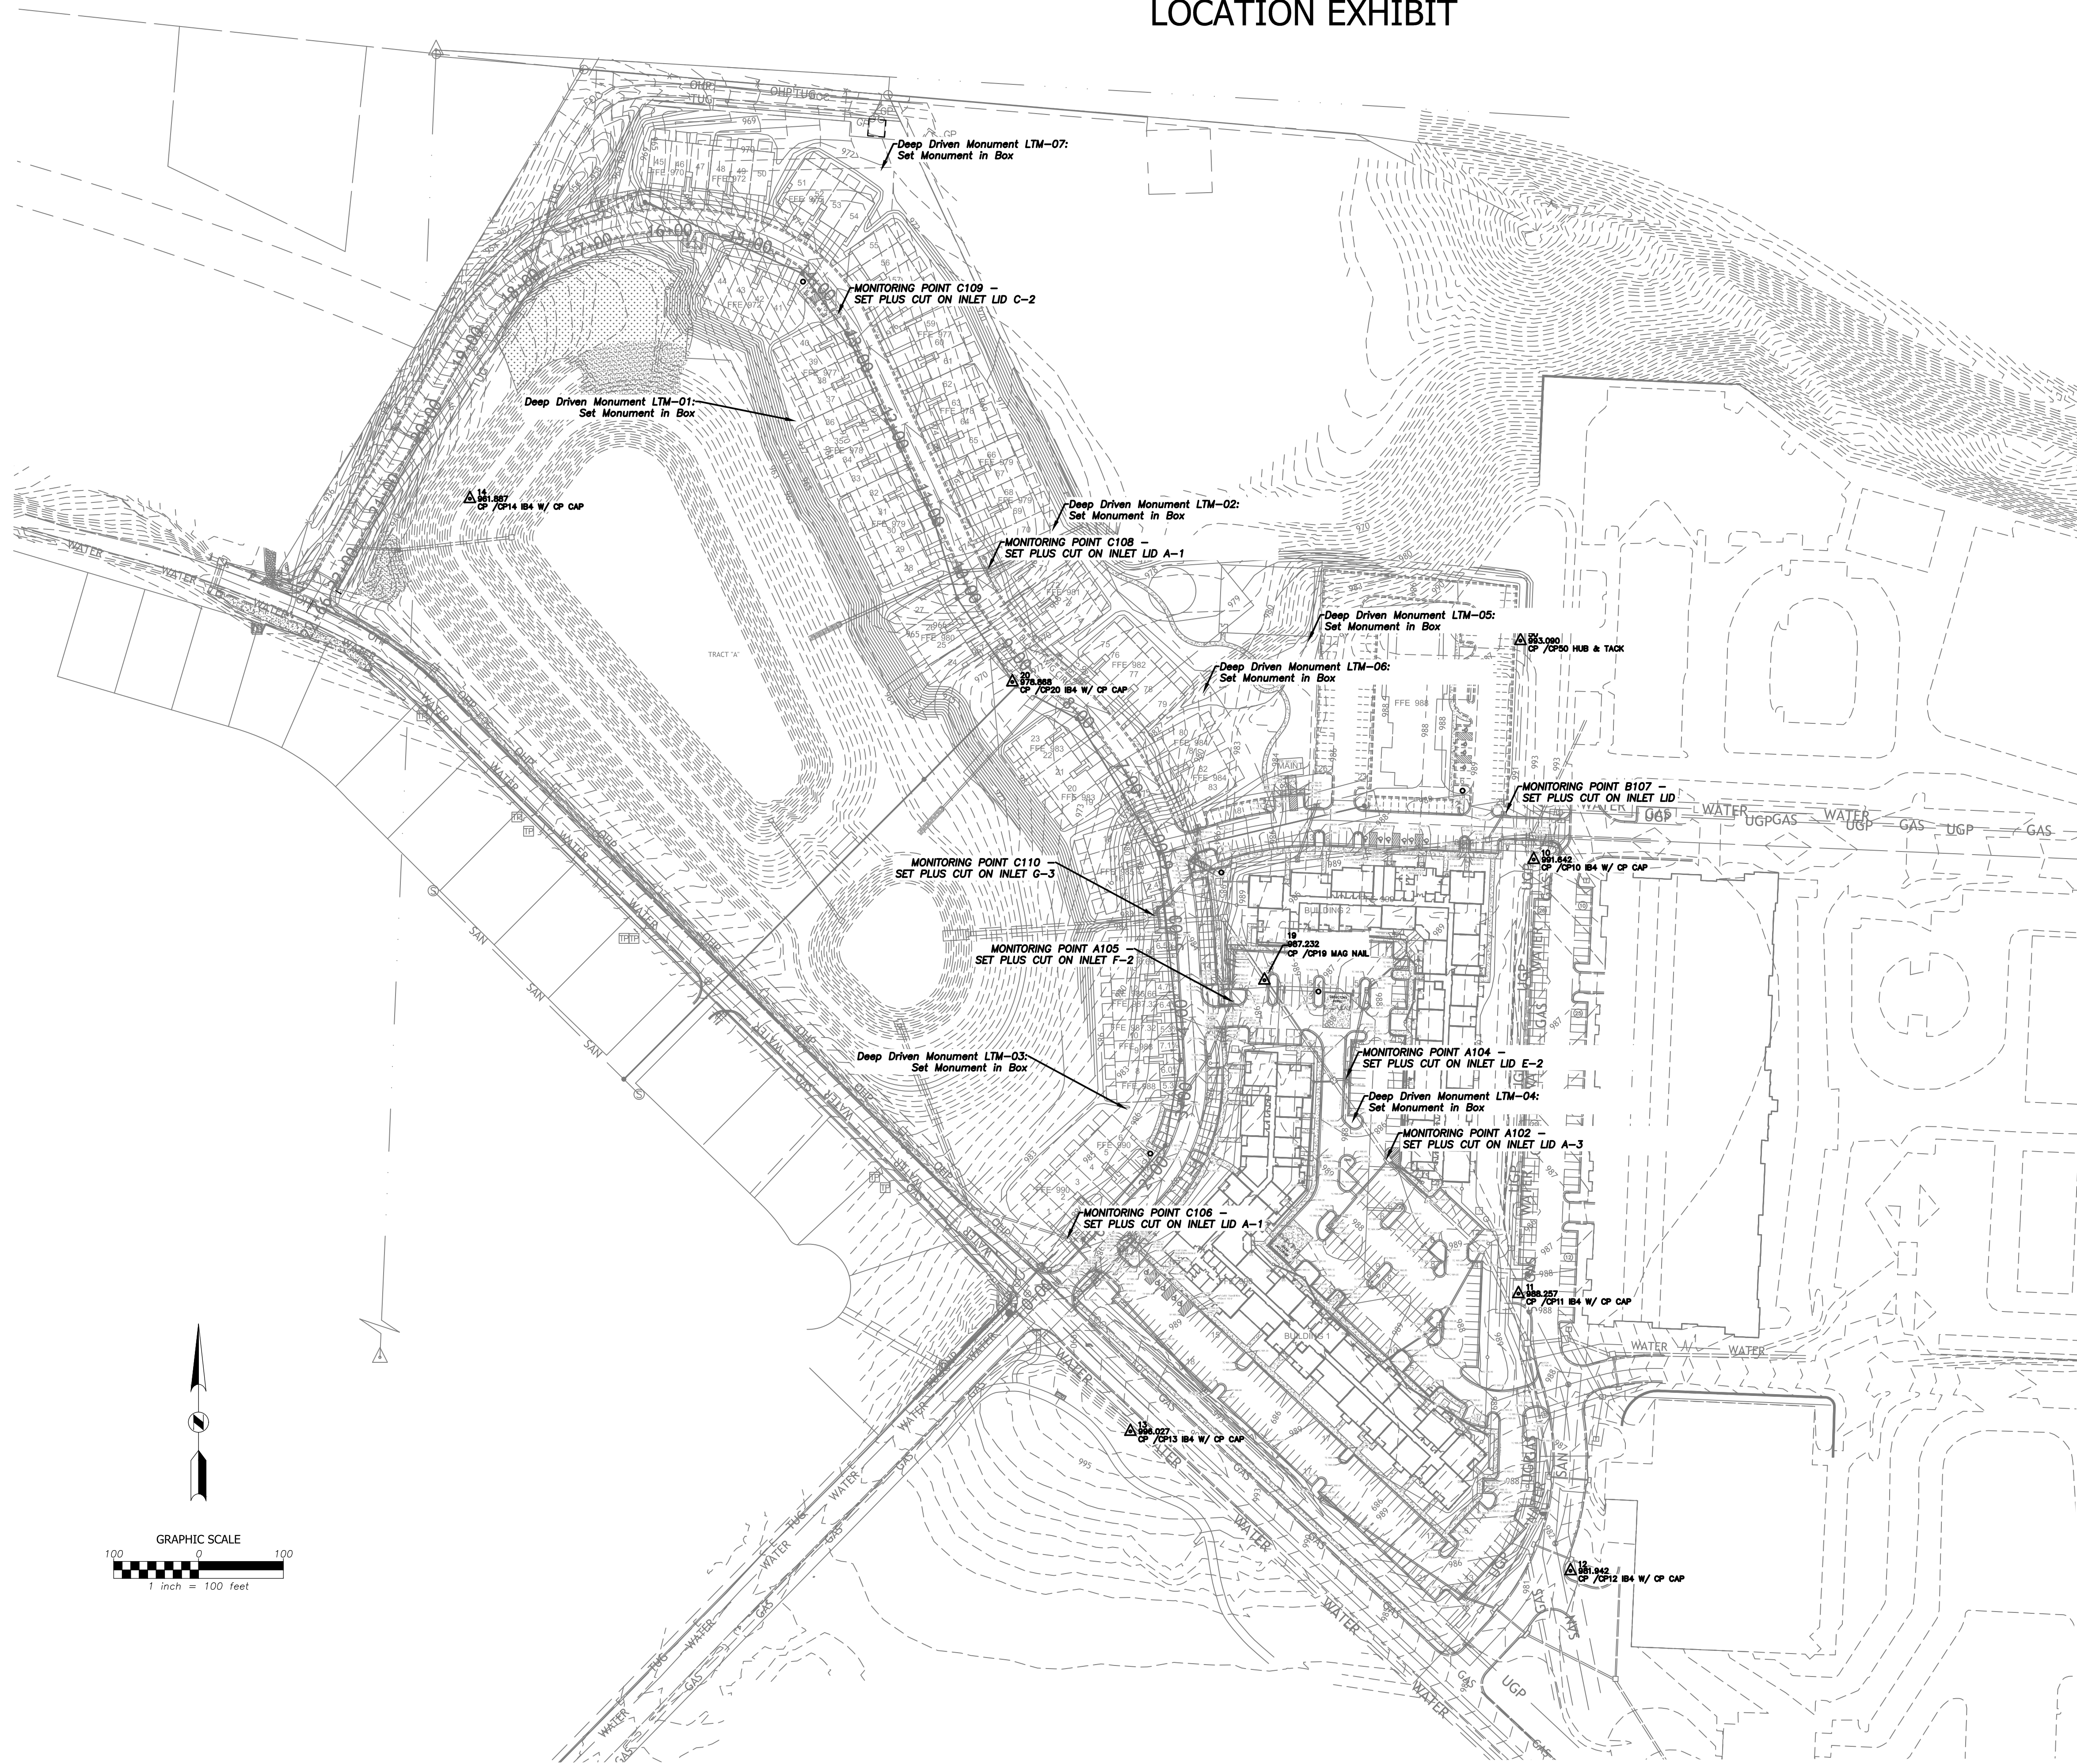

GENERAL NOTES

1. Basis of Bearings: Initial Monitoring control was derived from GPS Static data collected on several of the Monitoring Control Points and submitted to OPUS for data processing. The OPUS provided data was referenced to the Missouri State Plane Coordinate System, West Zone (NAD83). The coordinates derived from this OPUS solutions were then adjusted to ground using the CAF from the Final Plat of "Streets of West Pryor Lots 1 thru 14, Tracts "A", "B", "C", & "D". Using the CAF from the above mentioned plat allows the monitoring points to be on a similar datum to the proposed site design. The ground coordinates were scaled from zero using the CAF of 0.99990084.
2. The monitoring control and the initial monitoring points were then traversed using a Trimble SX10 instrument and subsequently adjusted using MicroSurvey StarNet Version 9 software. A level run was run through control points 10 thru 13 to assist in establishing the initial monitoring control.
3. Base Line Control Points were intentionally placed off of the site in order to avoid placing them over areas of the mine that are currently being remediated.
4. This monitoring survey is based on field work completed on the date shown in the title block.
5. Monitoring points are labeled to indicate which section of mine remediation zone that they are closest to and a point number to assist in the survey monitoring. Example A100 = "A" indicates the "A" remediation zone and "100" is the survey point used while monitoring.
6. It has been indicated that some of the inlet lids will be moved during the progress of the construction. It has been requested that when the inlets are being adjusted that monitoring will be taken before and after the inlet has been adjusted in order to maintain a viable monitoring point that will be maintained through the monitoring term.
7. Long Term Monitoring Monuments are deep driven rods drilled into the bedrock below the surface with aluminum caps and located in Monument Boxes on the surface.
8. LTM-01 location is estimated. Monument location was relocated to help avoid possible future conflicts and it's current location has not been confirmed.

Project:		Client:	
Streets of West Pryor Monitoring Exhibit Lots 7A, 7B, and 7C Section 35, Township 48, Range 32 Lee's Summit, Jackson County, Missouri		Monarch Acquisitions LLC Dave Olson P.O. Box 24302 Overland Park, KS 66283	
Project No: 028440.00.01		Field Crew: MS, ET ALL	
Field Date: 10/31/2022		Drawn By: MS	
Issue Date: 12/06/2022		Sheet: 1 OF 1	
Description		Rev.	
Date		Drawn	
Checked			

Streets of West Pryor Monitoring Spreadsheet

Initial Monitoring Point Locations Points Set Oct. 12, 2021

First Monitoring Results Dec. 12, 2021 Note: Differences Below Between Oct. 12, 2021 & Dec. 12, 2021

Point #	Northing	Easting	Elevation	Location	Point #	Northing Difference	Easting Difference	Elevation Difference	Observed Elevation	Location
100	1006796.43	2812899.00	992.88	Inlet	2100	-0.03	0.01	-0.04	992.84	
101	1006763.01	2812554.02	982.86	Inlet B-1	2101	-2.90	-2.00	0.01	982.87	
102	1006414.57	2812733.04	987.35	Inlet A-3	2102	1.55	-5.17	-0.02	987.33	
103	1006322.29	2812351.55	988.07	Inlet A-1		See Note Below				
	Value Greater than 0.08'				104	1006511.50	2812680.58	987.40		Inlet E-2
	Value Greater than 0.04'				105	1006601.94	2812547.13	986.35		Inlet F-2
	Value Greater than 0.02'				106	1006319.59	2812353.76	988.24		Inlet A-1

Note: Lid replaced and mark removed on Inlet A-1 after initial monitoring. Point's 104-106 above are new or replacement monitoring points on the site.

Inlet Lids on Structures B-1 and A-3 have been adjusted since the initial monitoring. The new location of points will now be monitored.

Note: Point's 10-14 on previous exhibits are Control Point's for monitoring and have been removed to simplify exhibit.

Point's 100-103 are monitoring points as shown on the exhibit.

Monitoring Point #100 is on an Inlet @ NE Corner of Site

Note: The certification on this exhibit is to verify that the horizontal and vertical positions shown hereon were collected under my direct supervision. This certification does not intend to show anything other what is shown on the exhibit. We are not certifying any reason or cause for the differences in the locations or elevations.



Streets of West Pryor Monitoring Spreadsheet

Second Monitoring Results

Feb. 4, 2022

Note: Differences Below Between

Oct. 12, 2021 & Feb. 4, 2022 (Point 100)

Dec. 12, 2021 & Feb. 4, 2022 (Points 101, 102, & 104-106)

Point #	Northing Difference	Easting Difference	Elevation Difference	Observed Elevation	Location	Point #	Northing Difference	Easting Difference	Elevation Difference	Observed Elevation	Location
3100	-0.04	-0.01	0.01	992.89	Inlet	4100	-0.03	-0.01	-0.04	992.84	Inlet
3101	-0.03	-0.06	0.06	982.92	Inlet B-1	4101	-0.01	-0.39	0.01	982.87	Inlet B-1
3102	-0.02	-0.03	0.02	987.37	Inlet A-3	4102	-0.02	-0.01	0.02	987.33	Inlet A-3
3104	0.00	-0.04	0.04	987.44	Inlet E-2	4104	0.01	-0.08	0.00	987.40	Inlet E-2
3105	-0.04	-0.05	0.06	986.41	Inlet F-2	4105	0.00	0.01	0.01	986.36	Inlet F-2
3106	0.02	-0.17	0.04	988.28	Inlet A-1	4106	0.04	-0.10	-0.03	988.21	Inlet A-1

Note: Differences Below Between

Dec. 12, 2021 & Feb. 4, 2022

3100	-0.01	-0.02	0.05	992.89
3101	-0.03	-0.06	0.05	982.92
3102	-0.02	-0.03	0.04	987.37

Note: Differences Below Between

Feb. 4, 2022 & March 2, 2022

4100	0.01	0.00	-0.05	992.84
4101	0.02	-0.33	-0.05	982.87
4102	0.00	0.02	-0.04	987.33
4104	0.01	-0.05	-0.04	987.40
4105	0.05	0.06	-0.05	986.36
4106	0.02	0.06	-0.07	988.21

Note: The certification on this exhibit is to verify that the horizontal and vertical positions shown hereon were collected under my direct supervision. This certification does not intend to show anything other what is shown on the exhibit. We are not certifying any reason or cause for the differences in the locations or elevations.



Streets of West Pryor Monitoring Spreadsheet

Fourth Monitoring Results

4/8/2022

Note: Differences Below Between
Dec. 12, 2021 & April 8, 2022

Point #	Northing Difference	Easting Difference	Elevation Difference	Observed Elevation	Location
Inlet Adjusted- Removed from Monitoring					
5102	-3.35	1.84	1.09	988.44	Inlet A-3
Based on above results, Inlet A-3 has shifted since last monitoring					
5104	0.00	-0.04	0.04	987.44	Inlet E-2
5105	-0.01	-0.02	0.02	986.37	Inlet F-2
5106	0.02	-0.09	0.00	988.24	Inlet A-1
107	1006824.68	2812868.80	990.01		Inlet I-2
108	1007111.59	2812258.87	979.05		Inlet A-1
109	1007411.19	2812081.44	975.28		Inlet C-2
110	1006703.64	2812454.33	984.07		Inlet G-3

Note: Point's 107-110 above are new
or replacement monitoring points on the site.

Note: Differences Below Between
March 2, 2022 & April 8, 2022

Inlet Adjusted- Removed from Monitoring					
5102	-3.33	1.85	1.11	988.44	
5104	-0.01	0.04	0.04	987.44	
5105	-0.01	-0.02	0.01	986.37	
5106	-0.03	0.02	0.03	988.24	

Note: The certification on this exhibit is to verify that the horizontal
and vertical positions shown hereon were collected under my
direct supervision. This certification does not intend to show anything
other what is shown on the exhibit. We are not certifying
any reason or cause for the differences in the locations or elevations



Streets of West Pryor Monitoring Spreadsheet

Fifth Monitoring Results 5/9/2022

Note: Differences Below Between

Dec. 12, 2021 & May 9, 2022 (Points 104 - 106)

April 8, 2022 & May 9, 2022 (Points 102 & 107 - 110)


Point #	Northing	Eastng	Elevation Difference	Observed Elevation	Location
6102	See Note		0.00	988.44	Inlet A-3
6104	See Note		0.01	987.41	Inlet E-2
6105	See Note		0.01	986.36	Inlet F-2
6106	See Note		0.03	988.27	Inlet A-1
6107	See Note		-0.02	989.99	Inlet I-2
6108	See Note		0.03	979.08	Inlet A-1
6109	See Note		0.00	975.28	Inlet C-2
6110	See Note		0.00	984.07	Inlet G-3
111	1006482.19	2812485.01	986.12		Inlet F-4

Note: Point #111 is a new monitoring point.

Note: Differences Below Between

April 8, 2022 & May 9, 2022

6104	-0.03	987.41	Inlet E-2
6105	-0.01	986.36	Inlet F-2
6106	0.03	988.27	Inlet A-1

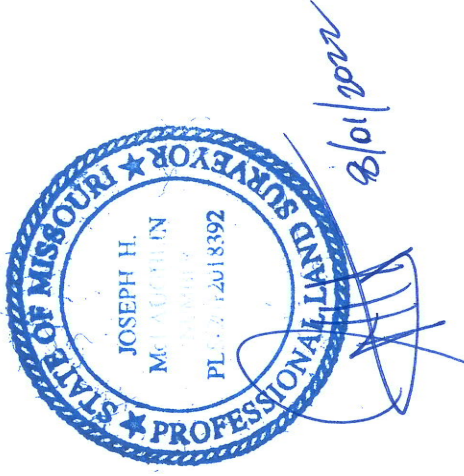

Note: This monitoring exhibit represents a shift in the data collection method for the monitoring at the Streets of West Pryor site. Long term monitoring will concentrate on the vertical differences between observations, unless otherwise noted.

Note: The certification on this exhibit is to verify the vertical positions shown hereon were collected under my direct supervision. This certification does not intend to show anything other what is shown on the exhibit. We are not certifying any reason or cause for the differences in elevations.

Streets of West Pryor Monitoring Spreadsheet

Sixth Monitoring Results

6/8/2022

Note: Differences Below Between

Dec. 12, 2021 & June 8, 2022 (Point's 104-106)

April 8, 2022 & June 8, 2022 (Point's 102, 107-110)

May 9, 2022 & June 8, 2022 (Point #111)

<u>Point #</u>	<u>Northing</u>	<u>Easting</u>	<u>Elevation Difference</u>	<u>Observed Elevation</u>	<u>Location</u>
7102			0.01	988.45	Inlet A-3
7104			0.02	987.42	Inlet E-2
7105			0.02	986.37	Inlet F-2
7106			-0.02	988.26	Inlet A-1
7107			-0.01	990.00	Inlet I-2
7108			0.01	979.06	Inlet A-1
7109			-0.03	975.25	Inlet C-2
7110			-0.02	984.05	Inlet G-3
7111			-0.02	986.10	Inlet F-4

Note: This monitoring exhibit continues a shift in the data collection method for the monitoring at the Streets of West Pryor site. Long term monitoring will concentrate on the vertical differences between observations, unless otherwise noted.



Note: Differences Below Between

May 9, 2022 & June 8, 2022

7102	0.01	988.45
7104	0.01	987.42
7105	0.01	986.37
7106	-0.01	988.26
7107	0.01	990.00
7108	-0.02	979.06
7109	-0.03	975.25
7110	-0.02	984.05
7111	-0.02	986.10

Note: The certification on this exhibit is to verify the vertical positions shown hereon were collected under my direct supervision. This certification does not intend to show anything other what is shown on the exhibit. We are not certifying any reason or cause for the differences in elevations.

Streets of West Pryor Monitoring Spreadsheet

Seventh Monitoring Results

7/21/2022

Note: Differences Below Between

Dec. 12, 2021 & July 21, 2022 (Point's 104-106)

April 8, 2022 & July 21, 2022 (Point's 102, 107-110)

May 9, 2022 & July 21, 2022 (Point #111)

<u>Point #</u>	<u>Northing</u>	<u>Easting</u>	<u>Elevation</u> <u>Difference</u>	<u>Observed</u> <u>Elevation</u>	<u>Location</u>
8102			0.03	988.47	Inlet A-3
8104			0.05	987.45	Inlet E-2
8105			0.04	986.39	Inlet F-2
8106		Inlet covered with fill			Inlet A-1
8107			-0.03	989.98	Inlet I-2
8108			0.01	979.06	Inlet A-1
8109			-0.02	975.26	Inlet C-2
8110			-0.05	984.02	Inlet G-3
8111			-0.02	986.10	Inlet F-4

Note: This monitoring exhibit continues a shift in the data collection method for the monitoring at the Streets of West Pryor site. Long term monitoring will concentrate on the vertical differences between observations, unless otherwise noted.



Note: Differences Below Between

June 8, 2022 & July 21, 2022

8102			0.02	988.47	Inlet A-3
8104			-0.03	987.45	Inlet E-2
8105			0.02	986.39	Inlet F-2
8106		Inlet covered with fill			Inlet A-1
8107			-0.02	989.98	Inlet I-2
8108			0.00	979.06	Inlet A-1
8109			0.01	975.26	Inlet C-2
8110			-0.03	984.02	Inlet G-3
8111			0.00	986.10	Inlet F-4

Note: The certification on this exhibit is to verify the vertical positions shown hereon were collected under my direct supervision. This certification does not intend to show anything other what is shown on the exhibit. We are not certifying any reason or cause for the differences in elevations.

Streets of West Pryor Monitoring Spreadsheet

Eighth Monitoring Results
9/14/2022

Note: Differences Below Between

Dec. 12, 2021 & Sept 14, 2022 (Point's 104-106)
April 8, 2022 & Sept 14, 2022 (Point's 102, 107-110)
May 9, 2022 & Sept 14, 2022 (Point #111)

Point #	Northing	Easting	Elevation Difference	Observed Elevation	Location
9102			0.01	988.45	Inlet A-3
9104			0.03	987.43	Inlet E-2
9105			0.04	986.39	Inlet F-2
		Inlet covered with fill			Inlet A-1
9107			-0.03	989.98	Inlet I-2
9108			0.01	979.06	Inlet A-1
		Inlet covered with Construction Supplies			Inlet C-2
9110			-0.06	984.01	Inlet G-3
9111			-0.02	986.10	Inlet F-4

Note: Long term monitoring will concentrate on the vertical differences between observations, unless otherwise noted.

Note: Differences Below Between

July 21, 2022 & Sept 14, 2022

9102	-0.02	988.45	Inlet A-3
9104	-0.02	987.43	Inlet E-2
9105	0.00	986.39	Inlet F-2
	Inlet covered with fill		Inlet A-1
9107	0.00	989.98	Inlet I-2
9108	0.00	979.06	Inlet A-1
	Inlet covered with Construction Supplies		Inlet C-2
9110	-0.01	984.01	Inlet G-3
9111	0.00	986.10	Inlet F-4

Note: The certification on this exhibit is to verify the vertical positions shown hereon were collected under my direct supervision. This certification does not intend to show anything other what is shown on the exhibit. We are not certifying any reason or cause for the differences in elevations.



Ninth Monitoring Results

10/31/2022

Note : Differences Below Between

Dec. 12, 2021 & Oct 31, 2022 (Point's 104-106)

April 8, 2022 & Oct 31, 2022 (Point's 102, 107-110)

May 9, 2022 & Oct 31, 2022 (Point #111)

<u>Point #</u>	<u>Elevation Difference</u>	<u>Observed Elevation</u>	<u>Location</u>
10102	0.01	988.45	Inlet A-3
10104	0.04	987.44	Inlet E-2
10105	0.04	986.39	Inlet F-2
			Inlet A-1
10107	0.10	990.11	Inlet I-2
10108	0.00	979.05	Inlet A-1
10109	-0.02	975.26	Inlet C-2
10110	-0.07	984.00	Inlet G-3
10111	-0.03	986.09	Inlet F-4

Note: Long term monitoring will concentrate on the vertical differences between observations, unless otherwise noted.

Note: Differences Below Between

Sept 14, 2022 & Oct 31, 2022 (Except #109; July 21, 2022 & Oct 31, 2022)

10102	0.00	988.45
10104	0.01	987.44
10105	0.00	986.39
10107	0.13	990.11
10108	-0.01	979.05
10109	0.00	975.26
10110	-0.01	984.00
10111	-0.01	986.09

Note: The certification on this exhibit is to verify the vertical positions shown hereon were collected under my direct supervision. This certification does not intend to show anything other what is shown on the exhibit. We are not certifying any reason or cause for the differences in elevations.

Long Term Monitoring Monuments

	975.06	LTM-01
Initial Elevation Readings	977.87	LTM-02
Shown at Right	987.88	LTM-03
	987.51	LTM-04
	985.19	LTM-05
	982.01	LTM-06
	971.82	LTM-07

Note: New Elevation of LTM-03 from found calculation error.



Tenth Monitoring Results

1/5/2023

Note : Differences Below Between

Dec. 12, 2021 & Jan 5, 2023 (Point's 104-106)

April 8, 2022 & Jan 5, 2023 (Point's 102, 107-110)

May 9, 2022 & Jan 5, 2023 (Point #111)

<u>Point #</u>	<u>Elevation Difference</u>	<u>Observed Elevation</u>	<u>Location</u>
10102	0.00	988.44	Inlet A-3
10104	0.02	987.42	Inlet E-2
10105	0.02	986.37	Inlet F-2
			Inlet A-1
10107	Inlet covered by Equipment		Inlet I-2
10108	-0.01	979.04	Inlet A-1
10109	-0.02	975.26	Inlet C-2
10110	-0.11	983.96	Inlet G-3
10111	-0.03	986.09	Inlet F-4

Note: Long term monitoring will concentrate on the vertical differences between observations, unless otherwise noted.

Note: Differences Below Between

Oct 31, 2022 & Jan 5, 2023(Except #109; July 21, 2022 & Jan 5, 2023)

10102	-0.01	988.44
10104	-0.02	987.42
10105	-0.02	986.37
10107	Inlet covered by Equipment	
10108	-0.01	979.04
10109	0.00	975.26
10110	-0.04	983.96
10111	0.00	986.09

Note: The certification on this exhibit is to verify the vertical positions shown hereon were collected under my direct supervision. This certification does not intend to show anything other what is shown on the exhibit. We are not certifying any reason or cause for the differences in elevations.

Long Term Monitoring Monuments

Note: Differences Below Between

Oct 31, 2022 & Jan 5, 2023

	0.00	975.06	LTM-01
	-0.01	977.86	LTM-02
	-0.01	987.87	LTM-03
	-0.02	987.49	LTM-04
	0.01	985.20	LTM-05
Disturbed, Needs Reset			LTM-06
	0.00	971.82	LTM-07



Eleventh Monitoring Results

3/9/2023

Note : Differences Below Between

Dec. 12, 2021 & March 9, 2023 (Point's 104-106)

April 8, 2022 & March 9, 2023 (Point's 102, 107-110)

May 9, 2022 & March 9, 2023 (Point #111)

<u>Point #</u>	<u>Elevation Difference</u>	<u>Observed Elevation</u>	<u>Location</u>
10102	0.00	988.44	Inlet A-3
10104	0.02	987.42	Inlet E-2
10105	0.03	986.38	Inlet F-2
			Inlet A-1
10107	0.08	990.09	Inlet I-2
10108	-0.01	979.04	Inlet A-1
10109	-0.05	975.23	Inlet C-2
10110	-0.11	983.96	Inlet G-3
10111	-0.02	986.10	Inlet F-4

Note: The certification on this exhibit is to verify the vertical positions shown hereon were collected under my direct supervision. This certification does not intend to show anything other what is shown on the exhibit. We are not certifying any reason or cause for the differences in elevations.

Note: Differences Below Between

Jan 5, 2023 & March 9, 2023

10102	0.00	988.44	Inlet A-3
10104	0.00	987.42	Inlet E-2
10105	0.01	986.38	Inlet F-2
			Inlet A-1
10107		990.09	Inlet I-2
10108	0.00	979.04	Inlet A-1
10109	-0.03	975.23	Inlet C-2
10110	0.00	983.96	Inlet G-3
10111	0.01	986.10	Inlet F-4



Long Term Monitoring Monuments

Note: Differences Below Between

Oct 31, 2022 & March 9, 2023

Jan 5, 2023 & March 9, 2023

Elevation Difference

Elevation Difference

-0.02	975.04	LTM-01
-0.01	977.86	LTM-02
0.00	987.88	LTM-03
-0.02	987.49	LTM-04
-0.01	985.18	LTM-05
-0.02	981.99	LTM-06
-0.03	971.79	LTM-07

-0.02
0.00
0.01
0.00
-0.02
Disturbed, Reset
-0.03

Twelfth Monitoring Results

6/7/2023

Note : Differences Below Between

Dec. 12, 2021 & June 7, 2023 (Point's 104-106)

April 8, 2022 & June 7, 2023 (Point's 102, 107-110)

May 9, 2022 & June 7, 2023 (Point #111)

<u>Point #</u>	<u>Elevation Difference</u>	<u>Observed Elevation</u>	<u>Location</u>
10102	0.00	988.44	Inlet A-3
10104	0.02	987.42	Inlet E-2
10105	0.03	986.38	Inlet F-2
			Inlet A-1
10107	0.09	990.10	Inlet I-2
10108	0.00	979.05	Inlet A-1
10109	0.00	975.28	Inlet C-2
10110	-0.11	983.96	Inlet G-3
10111	-0.03	986.09	Inlet F-4

Note: The certification on this exhibit is to verify the vertical positions shown hereon were collected under my direct supervision. This certification does not intend to show anything other what is shown on the exhibit. We are not certifying any reason or cause for the differences in elevations.

Note: Differences Below Between

March 9, 2023 & June 7, 2023

10102	0.00	988.44	Inlet A-3
10104	0.00	987.42	Inlet E-2
10105	0.00	986.38	Inlet F-2
			Inlet A-1
10107	0.01	990.10	Inlet I-2
10108	0.01	979.05	Inlet A-1
10109	0.05	975.28	Inlet C-2
10110	0.00	983.96	Inlet G-3
10111	-0.01	986.09	Inlet F-4



Long Term Monitoring Monuments

Note: Differences Below Between

Oct 31, 2022 & June 7, 2023

March 9, 2023 & June 7, 2023

Elevation Difference

Elevation Difference

-0.01	975.05	LTM-01	-0.01
0.00	977.87	LTM-02	-0.01
0.00	987.88	LTM-03	0.00
-0.02	987.49	LTM-04	0.00
	Disturbed	LTM-05	
-0.02	981.99	LTM-06	0.00
-0.01	971.81	LTM-07	-0.02

Thirteenth Monitoring Results

9/28/2023

Note : Differences Below Between

Dec. 12, 2021 & Sept. 28, 2023 (Point's 104-106)

April 8, 2022 & Sept 28, 2023 (Point's 102, 107-110)

May 9, 2022 & Sept 28, 2023 (Point #111)

<u>Point #</u>	<u>Elevation Difference</u>	<u>Observed Elevation</u>	<u>Location</u>
10102	0.02	988.46	Inlet A-3
10104	0.04	987.44	Inlet E-2
10105			Inlet F-2
			Inlet A-1
10107	0.08	990.09	Inlet I-2
10108	0.02	979.07	Inlet A-1
10109			Inlet C-2
10110	-0.10	983.97	Inlet G-3
10111	-0.01	986.11	Inlet F-4

Note: The certification on this exhibit is to verify the vertical positions shown hereon were collected under my direct supervision. This certification does not intend to show anything other what is shown on the exhibit. We are not certifying any reason or cause for the differences in elevations.

Note: Differences Below Between

June 7, 2023 & Sept 28, 2023

10102	0.02	988.46	Inlet A-3
10104	0.02	987.44	Inlet E-2
10105			Inlet F-2
			Inlet A-1
10107	-0.01	990.09	Inlet I-2
10108	0.02	979.07	Inlet A-1
10109			Inlet C-2
10110	0.01	983.97	Inlet G-3
10111	0.02	986.11	Inlet F-4



Long Term Monitoring Monuments

Note: Differences Below Between

Oct 31, 2022 & Sept 28, 2023

June 7, 2023 & Sept 28, 2023

Elevation Difference

Elevation Difference

0.01	975.07	LTM-01
0.02	977.89	LTM-02
0.02	987.90	LTM-03
0.00	987.51	LTM-04
	Disturbed	LTM-05
0.01	982.02	LTM-06
0.01	971.83	LTM-07

0.02
0.02
0.02
0.02
0.03
0.02

Forteenth Monitoring Results
1/18/2024

<u>Point #</u>	<u>Elevation Difference</u>	<u>Observed Elevation</u>	<u>Location</u>
10102			Inlet A-3
10104			Inlet E-2
10105			Inlet F-2
			Inlet A-1
10107			Inlet I-2
10108			Inlet A-1
10109			Inlet C-2
10110			Inlet G-3
10111			Inlet F-4

Note: The certification on this exhibit is to verify the vertical positions shown hereon were collected under my direct supervision. This certification does not intend to show anything other what is shown on the exhibit. We are not certifying any reason or cause for the differences in elevations.

10102			Inlet A-3
10104			Inlet E-2
10105			Inlet F-2
			Inlet A-1
10107			Inlet I-2
10108			Inlet A-1
10109			Inlet C-2
10110			Inlet G-3
10111			Inlet F-4

Note: Inlet BM's not observed in this cycle due to snow/ice cover on curb inlets on the property.



Long Term Monitoring Monuments

Note: Differences Below Between

Oct 31, 2022 & Jan 18, 2024	Jan 18, 2024	Sept 28, 2023 & Jan 18, 2024
<u>Elevation Difference</u>	<u>Elevation</u>	<u>Elevation Difference</u>
-0.03	975.03 LTM-01	-0.04
-0.02	977.85 LTM-02	-0.04
0.00	987.88 LTM-03	-0.02
-0.03	987.48 LTM-04	-0.03
	Disturbed LTM-05	
	Not Observed LTM-06	
-0.03	971.79 LTM-07	-0.03

Fifteenth Monitoring Results

6/3/2024

Note : Differences Below Between

Dec. 12, 2021 & June 3, 2024 (Point's 104-106)

April 8, 2022 & June 3, 2024 (Point's 102, 107-110)

May 9, 2022 & June 3, 2024 (Point #111)

<u>Point #</u>	<u>Elevation Difference</u>	<u>Observed Elevation</u>	<u>Location</u>
10102	0.03	988.47	Inlet A-3
10104	0.04	987.44	Inlet E-2
10105	0.03	986.39	Inlet F-2
10107			Inlet I-2
10108	-0.01	979.05	Inlet A-1
10109		975.29	Inlet C-2
10110	-0.12	983.96	Inlet G-3
10111	-0.01	986.11	Inlet F-4

Note: The certification on this exhibit is to verify the vertical positions shown hereon were collected under my direct supervision. This certification does not intend to show anything other what is shown on the exhibit. We are not certifying any reason or cause for the differences in elevations.

Note: Differences Below Between

Sept 28, 2023 or June 7, 2023 & June 3, 2024

10102	0.01	988.47	Inlet A-3
10104	0.00	987.44	Inlet E-2
10105	0.01	986.39	Inlet F-2
10107			Inlet I-2
10108	-0.02	979.05	Inlet A-1
10109	0.00	975.29	Inlet C-2
10110	-0.01	983.96	Inlet G-3
10111	0.00	986.11	Inlet F-4



Long Term Monitoring Monuments

Note: Differences Below Between

Oct 31, 2022 & June 3, 2024

June 3, 2024

Jan 18, 2024 & June 3, 2024

Elevation Difference

Elevation

Elevation Difference

-0.01	975.05	LTM-01	0.02
0.00	977.87	LTM-02	0.02
0.00	987.89	LTM-03	0.01
-0.01	987.50	LTM-04	0.01
	Disturbed	LTM-05	
0.00	982.01	LTM-06	N/A
-0.02	971.81	LTM-07	0.02

**Streets of West Pryor
Foundation Monitoring Results
January 22, 2024**

Initial Observed Elevations for Foundation Monitoring Nails

Note: 60D Nails drilled into Concrete Foundation and set to be observed for elevation.

<u>Observation #</u>	<u>Observed Elevation</u>	<u>Location</u>
TBM #1	982.77	SE Corner Unit #19
TBM #2	983.33	SW Corner Unit #19
TBM #3	983.39	NW Corner Unit #23

Note: The certification on this exhibit is to verify the vertical positions shown hereon were collected under my direct supervision. This certification does not intend to show anything other what is shown on the exhibit. We are not certifying any reason or cause for the differences in elevations.

**First Monitoring Results
June 3, 2024**

<u>Observation #</u>	<u>Observed Elevation</u>	<u>Elevation Difference</u>	<u>Location</u>
TBM #1	982.77	0.00	SE Corner Unit #19
TBM #2	983.31	-0.02	SW Corner Unit #19
TBM #3	983.36	-0.03	NW Corner Unit #23



**Monitoring Point Displacement Summary
Streets West of Pryor
Lee's Summit Missouri**

Displacement for A100

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
10/12/2021	NA	992.88	NA	NA	NA	NA	
12/12/2021	-0.03	992.84	0.17	-0.48	-0.48	-2.87	
2/4/2022	-0.01	992.89	0.15	0.60	0.12	4.06	
3/2/2022	0.01	992.84	0.07	-0.60	-0.48	-8.42	Inlet point moved, new baseline set
4/8/2022	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	Monitor point removed due to adjusting inlet

Displacement for A101

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
10/12/2021	NA	982.86	NA	NA	NA	NA	
12/12/2021	0.01	982.87	0.17	0.12	0.12	0.72	Inlet lid adjusted after initial monitoring
2/4/2022	0.05	982.92	0.15	0.60	0.72	4.06	
3/2/2022	-0.05	982.87	0.07	-0.60	0.12	-8.42	Inlet point moved, new baseline set
4/8/2022	#N/A	#N/A	#N/A	#N/A	#N/A	NA	Monitor point removed due to adjusting inlet

Displacement for A102

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
10/12/2021	NA	987.35	NA	NA	NA	NA	
12/12/2021	-0.02	987.33	0.17	-0.24	-0.24	-1.44	Inlet lid adjusted after initial monitoring
2/4/2022	0.04	987.37	0.15	0.48	0.24	3.24	
3/2/2022	-0.04	987.33	0.07	-0.48	-0.24	-6.74	Inlet point moved, new baseline set
4/8/2022	1.11	988.44	0.10	13.32	13.08	131.40	Inlet A-3 shifted since last monitoring
5/9/2022	0.00	988.44	0.08	0.00	13.08	0.00	Switch to vertical monitoring only
6/8/2022	0.01	988.45	0.08	0.12	13.20	1.46	
7/21/2022	0.02	988.47	0.12	0.24	13.44	2.04	
9/14/2022	-0.02	988.45	0.15	-0.24	13.20	-1.59	
10/31/2022	0	988.45	0.13	0.00	13.20	0.00	
1/5/2023	-0.01	988.44	0.18	-0.12	13.08	-0.66	
3/9/2023	0	988.44	0.17	0.00	13.08	0.00	
6/7/2023	0	988.44	0.25	0.00	13.08	0.00	
9/28/2023	0.02	988.46	0.31	0.24	13.32	0.78	
1/18/2024	0	988.46	0.31	0.00	13.32	0.00	No Survey b/c of ice & snow
6/3/2024	0.01	988.47	0.38	0.12	13.44	0.32	

Displacement for C103

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
10/12/2021	NA	NA	NA	NA	NA	NA	
12/12/2021	NA	NA	NA	NA	NA	NA	Removed after initial monitoring

Displacement for A104

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
12/12/2021	NA	987.40	#N/A	#N/A	#N/A	#N/A	
2/4/2022	0.04	987.44	0.15	0.48	0.48	3.24	
3/2/2022	-0.04	987.40	0.07	-0.48	0.00	-6.74	Inlet point moved, new baseline set
4/8/2022	0.04	987.44	0.10	0.48	0.48	4.74	
5/9/2022	-0.03	987.41	0.08	-0.36	0.12	-4.24	Switch to vertical monitoring only
6/8/2022	0.01	987.42	0.08	0.12	0.24	1.46	
7/21/2022	0.03	987.45	0.12	0.36	0.60	3.06	
9/14/2022	-0.02	987.43	0.15	-0.24	0.36	-1.59	

**Monitoring Point Displacement Summary
Streets West of Pryor
Lee's Summit Missouri**

10/31/2022	0.01	987.44	0.13	0.12	0.48	0.93	
1/5/2023	-0.02	987.42	0.18	-0.24	0.24	-1.33	
3/9/2023	0	987.42	0.17	0.00	0.24	0.00	
6/7/2023	0	987.42	0.25	0.00	0.24	0.00	
9/28/2023	0.02	987.44	0.31	0.24	0.48	0.78	
1/18/2024	0	987.44	0.31	0.00	0.48	0.00	No Survey b/c of ice & snow
6/3/2024	0	987.44	0.38	0.00	0.48	0.00	

Displacement for A105

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
12/12/2021	NA	986.35	NA	NA	NA	NA	
2/4/2022	0.06	986.41	0.15	0.72	0.72	4.87	
3/2/2022	-0.05	986.36	0.07	-0.60	0.12	-8.42	Inlet point moved, new baseline set
4/8/2022	0.01	986.37	0.10	0.12	0.24	1.18	
5/9/2022	-0.01	986.36	0.08	-0.12	0.12	-1.41	Switch to vertical monitoring only
6/8/2022	0.01	986.37	0.08	0.12	0.24	1.46	
7/21/2022	0.02	986.39	0.12	0.24	0.48	2.04	
9/14/2022	0.00	986.39	0.15	0.00	0.48	0.00	
10/31/2022	0	986.39	0.13	0.00	0.48	0.00	
1/5/2023	-0.02	986.37	0.18	-0.24	0.24	-1.33	
3/9/2023	0.01	986.38	0.17	0.12	0.36	0.70	
6/7/2023	0.00	986.38	0.25	0.00	0.36	0.00	
9/28/2023	0	986.38	0.31	0.00	0.36	0.00	No Surveyor Notes on Missing Data.
1/18/2024	0.00	986.38	0.31	0.00	0.36	0.00	No Survey b/c of ice & snow
6/3/2024	0.01	986.39	0.38	0.12	0.48	0.32	

Displacement for C106

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
12/12/2021	NA	988.24	NA	NA	NA	NA	
2/4/2022	0.04	988.28	0.15	0.48	0.48	3.24	
3/2/2022	-0.07	988.21	0.07	-0.84	-0.36	-11.79	Inlet point moved, new baseline set
4/8/2022	0.03	988.24	0.10	0.36	0.00	3.55	
5/9/2022	0.03	988.27	0.08	0.36	0.36	4.24	Switch to vertical monitoring only
6/8/2022	-0.01	988.26	0.08	-0.12	0.24	-1.46	
7/21/2022	NA	NA	NA	NA	NA	NA	Inlet covered with fill
9/14/2022	NA	NA	NA	NA	NA	NA	Inlet covered with fill
10/31/2022	NA	NA	NA	NA	NA	NA	Inlet covered with fill
1/5/2023	NA	NA	NA	NA	NA	#VALUE!	Inlet covered with fill

Displacement for B107

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
4/8/2022	NA	990.01	NA	NA	NA	NA	
5/9/2022	-0.02	989.99	0.08	-0.24	-0.24	-2.83	Switch to vertical monitoring only
6/8/2022	0.01	990.00	0.08	0.12	-0.12	1.46	
7/21/2022	-0.02	989.98	0.12	-0.24	-0.36	-2.04	
9/14/2022	0.00	989.98	0.15	0.00	-0.36	0.00	
10/31/2022	0.13	990.11	0.13	1.56	1.20	12.11	Broken concrete curbs around inlet
1/5/2023	-0.01	990.10	0.18	-0.12	1.08	-0.66	Covered by Equip. Avg 10/31/22 & 3/9/23
3/9/2023	-0.01	990.09	0.17	-0.12	0.96	-0.70	
6/7/2023	0.01	990.10	0.25	0.12	1.08	0.49	
9/28/2023	0.08	990.09	0.31	0.96	0.96	3.10	
1/18/2024	0.00	990.09	0.31	0.00	0.96	0.00	No Survey b/c of ice & snow

**Monitoring Point Displacement Summary
Streets West of Pryor
Lee's Summit Missouri**

6/3/2024	0	990.09	0.38	0.00	0.96	0.00	Unable to SMP
----------	---	--------	------	------	------	------	---------------

Displacement for C108

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
4/8/2022	NA	979.05	NA	NA	NA	NA	
5/9/2022	0.03	979.08	0.08	0.36	0.36	4.24	Switch to vertical monitoring only
6/8/2022	-0.02	979.06	0.08	-0.24	0.12	-2.92	
7/21/2022	0.00	979.06	0.12	0.00	0.12	0.00	
9/14/2022	0.00	979.06	0.15	0.00	0.12	0.00	
10/31/2022	-0.01	979.05	0.13	-0.12	0.00	-0.93	
1/5/2023	-0.01	979.04	0.18	-0.12	-0.12	-0.66	
3/9/2023	0.00	979.04	0.17	0.00	-0.12	0.00	
6/7/2023	0.01	979.05	0.25	0.12	0.00	0.49	
9/28/2023	0.02	979.07	0.31	0.24	0.24	0.78	
1/18/2024	0.00	979.07	0.31	0.00	0.24	0.00	No Survey b/c of ice & snow
6/3/2024	-0.02	979.05	0.38	-0.24	0.00	-0.64	

Displacement for C109

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
4/8/2022	NA	975.28	NA	NA	NA	NA	
5/9/2022	0	975.28	0.08	0.00	0.00	0.00	Switch to vertical monitoring only
6/8/2022	-0.03	975.25	0.08	-0.36	-0.36	-4.38	
7/21/2022	0.01	975.26	0.12	0.12	-0.24	1.02	
9/14/2022	0	975.26	0.15	0.00	-0.24	0.00	Inlet covered with construction supplies
10/31/2022	0	975.26	0.13	0.00	-0.24	0.00	Construcion supplies removed
1/5/2023	0	975.26	0.18	0.00	-0.24	0.00	
3/9/2023	-0.03	975.23	0.17	-0.36	-0.60	-2.09	
6/7/2023	0.05	975.28	0.25	0.60	0.00	2.43	
9/28/2023	0	975.28	0.31	0.00	0.00	0.00	
1/18/2024	0	975.28	0.31	0.00	0.00	0.00	No Survey b/c of ice & snow
6/3/2024	0	975.28	0.38	0.00	0.00	0.00	Unable to Locate SMP

Displacement for C110

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
4/8/2022	NA	984.07	NA	NA	NA	NA	
5/9/2022	0	984.07	0.08	0.00	0.00	0.00	Switch to vertical monitoring only
6/8/2022	-0.02	984.05	0.08	-0.24	-0.24	-2.92	
7/21/2022	-0.03	984.02	0.12	-0.36	-0.60	-3.06	
9/14/2022	-0.01	984.01	0.15	-0.12	-0.72	-0.80	
10/31/2022	-0.01	984.00	0.13	-0.12	-0.84	-0.93	
1/5/2023	-0.04	983.96	0.18	-0.48	-1.32	-2.65	
3/9/2023	0	983.96	0.17	0.00	-1.32	0.00	
6/7/2023	0	983.96	0.25	0.00	-1.32	0.00	
9/28/2023	0.01	983.97	0.31	0.12	-1.20	0.39	
1/18/2024	0	983.97	0.31	0.00	-1.20	0.00	No Survey b/c of ice & snow
6/3/2024	-0.01	983.96	0.38	-0.12	-1.32	-0.32	

Displacement for C111

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
5/9/2022	NA	986.12	NA	NA	NA	NA	Monitor point installed
6/8/2022	-0.02	986.10	0.08	-0.24	-0.24	-2.92	
7/21/2022	0.00	986.10	0.12	0.00	-0.24	0.00	

**Monitoring Point Displacement Summary
Streets West of Pryor
Lee's Summit Missouri**

9/14/2022	0.00	986.10	0.15	0.00	-0.24	0.00	
10/31/2022	-0.01	986.09	0.13	-0.12	-0.36	-0.93	
1/5/2023	0.00	986.09	0.18	0.00	-0.36	0.00	
3/9/2023	0.01	986.10	0.17	0.12	-0.24	0.70	
6/7/2023	-0.01	986.09	0.25	-0.12	-0.36	-0.49	
9/28/2023	0.02	986.11	0.31	0.24	-0.12	0.78	
1/18/2024	0.00	986.11	0.31	0.00	-0.12	0.00	No Survey b/c of ice & snow
6/3/2024	0.00	986.11	0.38	0.00	-0.12	0.00	

Displacement for TBM1

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
1/22/2024	#N/A	982.77	#N/A	#N/A	#N/A	#N/A	Installed @ SE Corner Unit #19
6/3/2024	0.00	982.77	0.36	0.00	0.00	0.00	

Displacement for TBM2

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
1/22/2024	#N/A	983.33	#N/A	#N/A	#N/A	#N/A	Installed @ SW Corner Unit #19
6/3/2024	-0.02	983.31	0.36	-0.24	-0.24	-0.66	

Displacement for TBM3

Date	Elevation Change (ft)	Elevation (ft)	Time Elapsed (yr)	Elevation Change (in)	Total Elevation Change (in)	Rate (in/yr)	Remarks
1/22/2024	#N/A	983.39	#N/A	#N/A	#N/A	#N/A	Installed @ NW Corner Unit #23
6/3/2024	-0.03	983.36	0.36	-0.36	-0.36	-0.99	

*Negative values indicate a decrease in elevation

