



GEOTECHNICAL EXPLORATION AND SUBGRADE RECOMMENDATIONS

WOODSPRINGS SUITES

Lee's Summit, Missouri

CFS Project No. 22-5831

Prepared For

Genesis Companies

4420 Madison Avenue

Kansas City, Missouri 64111

June 14, 2023

Prepared by:
Cook, Flatt & Strobel Engineers, P.A.
1100 W. Cambridge Circle Drive, Suite 700
Kansas City, Kansas 66103
913.627.9040

One Vision. One Team. One Call.

SYNOPSIS

A subsurface exploration and an evaluation were performed at the planned WoodSpring Suites project site located in Lee's Summit, Missouri to provide geotechnical engineering related recommendations for design and construction of the proposed project.

Exploratory soil borings have been drilled and a laboratory testing program was conducted on selected soil samples. The data has been analyzed based upon the project information provided by Genesis Companies and the project team.

The results of the exploration and analysis indicate that a shallow foundation system can be utilized in support of the planned structure given a ground improvement system such as rammed aggregate piers are utilized to stabilize and strengthen the subsurface materials prior to loading. Detailed analysis of subsurface conditions, any alternate foundation types, and pertinent design recommendations are included, herein.

Groundwater conditions are not expected to cause any major difficulties. These conditions will be further discussed in the report. Please note, groundwater levels should be expected to fluctuate based on seasonal changes and precipitation events.

TABLE OF CONTENTS

1	Introduction	1
1.1	Purpose.....	1
1.2	Scope of Services	1
1.3	General.....	1
2	Project Description	2
2.1	Site Location & Surface Conditions.....	2
2.2	Site Geology	2
3	Subsurface Exploration	3
3.1	Scope of Work	3
3.2	Drilling and Sampling Procedures	3
3.3	Field Tests and Measurements.....	3
3.4	Subsurface Conditions	4
3.5	Groundwater Conditions	4
4	Laboratory Testing.....	4
5	Geotechnical Concerns	5
6	Earthwork & Site Development.....	6
6.1	Site Preparation.....	6
6.2	Fill Materials.....	6
6.3	Engineered Fill Placement	6
6.4	Excavations & Trenches.....	7
6.5	Drainage and Dewatering	8
6.6	Landscaping	8
7	Geotechnical Engineering Recommendations	9
7.1	Foundations Recommendations – Rammed Aggregate Piers	9
7.2	Seismic Analysis.....	9
7.3	Slab on Grade Recommendations	10
7.4	Lateral Earth Pressures	10
7.5	Pavement Recommendations.....	12
8	General Comments	15

Appendix A: Figures

Figure 1 – Project Location

Figure 2 – Boring Location Plan

Appendix B: Boring Logs

Geotechnical Exploration and Foundation Recommendations

WOODSPRING SUITES LEE'S SUMMIT, MISSOURI

Project Number: 22-5831

June 14, 2023

1 INTRODUCTION

1.1 PURPOSE

The purpose of this geotechnical exploration was to evaluate the underlying materials at the proposed WoodSpring Suites project site, and based upon this information, provide geotechnical engineering related recommendations for design and construction of the planned project. This exploration was performed in accordance with Cook Flatt & Strobel Engineers,' P.A. (CFS) proposal numbered 22-191, dated November 9, 2022, and authorized by Renita Sommers of Genesis Companies.

This report includes geotechnical recommendations and considerations pertaining to site development, foundation support, concrete slab on grade and pavement construction. Also included in this report are earthwork, construction and drainage considerations associated with the proposed project.

1.2 SCOPE OF SERVICES

This exploration and analysis included an engineering reconnaissance of the planned site, a subsurface exploration as outlined below, a field and laboratory testing program, and an engineering analysis and evaluation of the subsurface materials.

The scope of services did not include any environmental assessment for wetlands or hazardous materials in the soil, surface water, groundwater, air, or surrounding area. Any statement in this report or on the boring logs regarding odors, colors or unusual or suspicious items is strictly for the information of the client.

1.3 GENERAL

The general subsurface conditions used in this analysis are based upon an interpolation of the subsurface data between the borings; varying conditions may be encountered between boring locations. If deviations from the noted subsurface conditions are encountered during construction, they should be brought to the attention of the Geotechnical Engineer.

The recommendations submitted for the proposed structure are based on the available soil information and the preliminary design details. Any revision in the plans for the proposed structure from those described in this report should be brought to the attention of the Geotechnical Engineer to determine if changes in the foundation recommendations are required.

The Geotechnical Engineer warrants that the findings, recommendations, specifications, and professional advice contained, herein, have been presented after being prepared in accordance with generally accepted professional engineering practice in the fields of foundation engineering, soil mechanics and engineering geology. No other warranties are implied or expressed.

After the plans and specifications are complete, it is recommended that the Geotechnical Engineer be provided the opportunity to review the final design and specifications, in order to verify that the earthwork and foundation recommendations are properly interpreted and implemented. Additionally, CFS should be allowed to perform construction inspections on any foundation elements of the project to validate these recommendations.

2 PROJECT DESCRIPTION

It is understood that the planned project comprises the new construction of a four (4) -story, wood framed, concrete slab on grade WoodSpring Suites Hotel in Lee's Summit, Missouri. Currently, the plan is to have an L-shaped building with asphalt pavements and drive lanes surrounding the structure. The proposed finish floor elevation was not available at the time of this report, however, CFS anticipates it will be similar to that of the existing grade. Foundation loads are expected to be on the order of 150 kips for column footings and two three (3) to five (5) kips per linear foot for continuous wall footings.

CFS anticipates minimal cut and fill, less than three (3) feet plus or minus, will be necessary to achieve the desired construction grade. If any changes to the project occur, please notify CFS to allow for a review of these changes and, if necessary, amend this report.

2.1 SITE LOCATION & SURFACE CONDITIONS

The project site is bound by NW Ward Road to the north, Outerview Road to the east, and existing parking lots to the south and west. A large commercial use building also resides to the southwest, beyond the parking lots.

At the time of this exploration, the planned project site was a grass covered, undeveloped lot. It generally grades downward from southwest to the northeast. A drainage swale running parallel with NW Ward Road comprises the north and northeast border of the site.

2.2 SITE GEOLOGY

Soils in the greater Kansas City area are generally residual soils, alluvial deposits, or tills. Residual soils formed as a result of weathering of bedrock, or by weathering of sediments that were transported by water, ice, wind, or a combination of these. Regional soils derived from shale, limestone, and loess have high shrink-swell potentials. Major alluvial deposits occur along the Missouri and Kansas rivers and their tributaries. These consist of clay, sand, and gravel sized sediments. Northern parts of the city were glaciated during the early Pleistocene time resulting in till deposits. Surface bedrock in northeastern Kansas and northwestern Missouri generally consist of limestone and shale (with sandstone found in prehistoric channels) arranged in nearly horizontal beds or layers that can be followed continuously over long distances. These bedrocks are part of the Pennsylvanian bedrock system.

3 SUBSURFACE EXPLORATION

Based on the project information as outlined above, CFS Engineers conducted a field exploration to determine the underlying materials at the proposed project site and to establish their engineering characteristics.

3.1 SCOPE OF WORK

This geotechnical exploration consisted of drilling three (3) borings within the footprint of the planned structure and five (5) borings in the associated pavement areas. The structure and pavement borings had planned depths of 20 and five (5) feet beneath existing site grade, respectively. The borings were drilled to their planned depth or auger refusal, whichever occurred first. The boring locations can be seen on the Boring Location Plan which is included in Appendix A.

The boring locations were determined in the field using measurements from existing landmarks and should be considered accurate only to the degree implied. The locations were established by Cook, Flatt & Strobel Engineers.

Boring logs representing the materials encountered in the borings are included in Appendix B. The boring logs represent CFS Engineers' interpretation of the field logs combined with laboratory observations and testing of the samples. The stratification boundaries indicated on the boring logs were based on field observations, an extrapolation of information obtained by examining samples from the borings, and comparisons of soils and/or bedrock types with similar engineering characteristic. As such, the boundaries between subsurface strata should be expected to vary from the logs to some extent.

The depth to groundwater, if encountered, was recorded in each test boring during drilling and can be seen in Section 3.5, Groundwater Conditions. After completion of drilling, sampling, and field testing, the excavations were backfilled with auger cuttings.

3.2 DRILLING AND SAMPLING PROCEDURES

The auger borings were drilled using a truck mounted SIMCO 2400 drill rig equipped with a rotary head. 3.25-inch solid-stem augers were used to drill the holes. During drilling, field logs were created and maintained by CFS personnel to catalog the materials encountered.

Representative samples were obtained during drilling using split-barrel sampling procedures in general accordance with the procedures for "Standard Test Methods for Standard Penetration Test (SPT) and Split-Barrel Sampling of Soils" (ASTM D 1586).

Upon completion of drilling, the samples were then sealed and returned to CFS's laboratory for further examination, classification, and testing. The samples recovered were identified, classified, and evaluated by a Geotechnical Engineer.

3.3 FIELD TESTS AND MEASUREMENTS

During the soil boring procedure, Standard Penetration Tests (SPT) were performed at pre-determined intervals to obtain the standard penetration value of the soil as outlined in the ASTM D1586 test method. The standard penetration value (N) is defined as the number of blows of a 140-pound hammer falling 30

inches, required to advance the split-barrel sampler one foot into the soil. The sampler is lowered to the bottom of the previously cleaned drill hole and advanced by blows from the hammer.

The number of blows is recorded for each of three successive increments of six inches penetration. The "N" value is then obtained by adding the second and third incremental numbers. The results of the standard penetration test are shown on the Boring Logs and indicate the relative density of cohesionless soils and comparative consistency of cohesive soils, and thereby provide a basis for estimating the relative strength and compressibility of the soil profile components.

The Standard Penetration Test (SPT) was also used to evaluate the consistency of the in-situ materials. The N-values for the site's materials were found to range from four (4) to 13 blows/foot.

3.4 SUBSURFACE CONDITIONS

The materials encountered in the test borings have been visually classified according to the Unified Soil Classification System (USCS). Specific subsurface conditions encountered—including field tests, lab tests, and water level observations—at the boring locations are also presented on the individual boring logs found in Appendix B of this report. The following table presents a general summary of the major strata encountered during this subsurface exploration.

Table 1: General Subsurface Conditions

STRATUM	MATERIAL	DEPTH TO TOP OF STRATUM (FT)	DEPTH TO BOTTOM OF STRATUM (FT)	MEASURED N-VALUES	COMMENTS
1	GRAVEL	0.0	1	NA	With asphalt and clay mixed in.
2	ROCKY FILL	1	4	NA	Rocky fill with clay mixed in.
3	FILL	4	20	4 to 13	Fat clay with gravel mixed. Different shades of brown. Moist

Note: the boundaries between subsurface strata should be expected to vary from this table and the logs to some extent.

3.5 GROUNDWATER CONDITIONS

Groundwater was not encountered in the borings at the time of the investigation. Please note, the reported groundwater levels reflect the conditions observed at the time the borings were drilled. Groundwater levels should be expected to fluctuate with changes in grading, precipitation changes and seasonal changes. The water levels included in this report do not indicate a permanent groundwater condition. Additionally, the materials encountered during this exploration are, generally, low permeable soils.

4 LABORATORY TESTING

Upon completion of drilling, the samples were returned to CFS's laboratory located in Kansas City, Kansas for laboratory testing. A supplemental laboratory testing program was conducted to evaluate additional

engineering characteristics of the in-situ soils necessary in analyzing the behavior of the support systems for the proposed building.

The laboratory testing program included the following tests:

- Supplementary visual classification (ASTM D2488) of all samples,
- Water content (ASTM D2216) of all samples, and
- Atterberg limit tests (ASTM D4318) on a selected sample.

The results of the laboratory testing program can be seen in on the boring logs in Appendix B. The Atterberg limits can be seen in the following table.

Table 2: Atterberg Limits Results

BORING ID	SAMPLE #	MOISTURE CONTENT (%)	ATTERBERG LIMITS			USCS CLASSIFICATION
			LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	
B3	SPT-1	24.1	45	22	23	LEAN CLAY (CL)

Based on the Atterberg limits, the reddish-brown overburden material classifies as Lean Clay (CL) and is considered highly expansive. To limit the risk of differential slab movements, all concrete slabs on grade should be constructed in accordance with Section 7.3, "Slab on Grade Recommendations" of this report.

5 GEOTECHNICAL CONCERNS

The following geotechnical concerns are based upon the subsurface materials encountered during this exploration and CFS's understanding of the project as described in Section 2, "Project Description" of this report. If any changes to the planned structure's location, loading or elevations occur, CFS must be allowed to review these changes, and if necessary, issue amendments to this report and its recommendations.

1. *Undocumented Fill*: Undocumented fill was encountered at the project site, and it extended to the bottom of the borings which were terminated at a depth of 20 feet beneath existing grade. Undocumented fill is inconsistent and unpredictable, in nature, and it should not be used in direct support of any foundation systems unless first stabilized with a ground improvement system such as rammed aggregate piers. Please reference Section 7, "Foundation Recommendations" for more information.
2. *Expansive Clay Soils*: Expansive clay soils were encountered during this exploration. The on-site materials are NOT suitable for direct support of concrete slabs. All slabs on grade should be supported by a minimum 24-in-thick mat of low volume change material (LVC) constructed in accordance with Section 7.3, "Slab on Grade Recommendations" of this report.

6 EARTHWORK & SITE DEVELOPMENT

6.1 SITE PREPARATION

Prior to filling, the grass and topsoil should be stripped from all structural areas and be stockpiled for later use in landscape areas, or it should be wasted. Any trees and shrubs should be removed including the entirety of the root ball and root systems. The upper 12-inches of the subgrade should be moisture conditioned and recompacted, as necessary, to provide a stable subgrade upon which to begin placement of engineered fill.

Upon completion of stripping and prior to filling, the newly exposed subgrade should be evaluated by a qualified professional for stability by means of proof rolling. The proof roll should be conducted using a fully loaded, tandem axle dump truck weighing in excess of 25 tons. Any soft or unsuitable areas identified during the proof roll should be corrected by means of additional moisture conditioning and recompacting, or removal and replacement with an acceptable material.

6.2 FILL MATERIALS

All general and structural fill should be free of debris and defined by ASTM 2487 as CH, CL, ML, GW, GP, SM, SW, SC, and SP. The onsite soils tend to meet this requirement; however, please note that CH (fat clay) classification materials should NOT be used as structural fill within two (2) feet of the finished grade supporting the building slab and within ten (10) feet laterally outside of the building footprint. Fat clays (CH) with Liquid Limits of greater than 55 should not be used in the upper one (1) foot beneath the pavement without being treated with cement as outlined later in this report.

The on-site topsoil contains organic material and is unsuitable for use as structural fill. Unsuitable materials are those defined by ASTM 2487 as MH, OL, OH, and PT.

6.3 ENGINEERED FILL PLACEMENT

For the purpose of this report, engineered fill means fill placed in controlled layers and compacted and tested according to accepted geotechnical engineering practices to ensure that it meets the required specifications. Structural fill refers to any engineered fill placed within the footprint of the planned structures or pavements. Engineered fill materials should be free of organic matter. During placement, engineered fill materials should be within the specified moisture contents and compacted to the specified densities given below in Tables two (2) and three (3). Maximum dry density and optimum moisture content should be determined by the Standard Proctor test (ASTM D 698).

Fill should be placed in six (6) inch lifts (compacted thickness) in mass fill areas, and as needed to obtain the proper compaction in utility trenches and behind walls. Structural fill should extend a minimum of two (2) feet beyond any structure lines. *Additionally, where slopes exist, engineered fill must be properly benched into the existing materials.*

Table 3: Recommended Moisture Ranges

ENGINEERED FILL MATERIAL	MAXIMUM BELOW OPTIMUM	MAXIMUM ABOVE OPTIMUM
Lean Clay (CL)	-2%	+3%
Fat Clay (CH)	0%	+4%
Compacted Base Rock (i.e., MODOT Type 5, AB3 or equivalent)	NA	NA

Table 4: Compaction Requirements & Testing Frequency

LOCATION OR AREA	REQUIRED COMPACTION (%) (ASTM D 698, DRY DENSITY)	TESTING FREQUENCY 3 PER LIFT PER ...
Building Walkways	95%	20,000 sf
Retaining Walls	95%	1,000 sf
Trenches	95%	150 lf
Lawn or Unimproved Areas	92%	20,000 sf
Structural Fill (i.e., building and pavement subgrades)	95%	10,000 sf
Out-Parcels	95%	20,000 sf

A representative of the Geotechnical Engineer should monitor filling operations on a full-time basis. A sufficient number of density tests should be taken to verify that the specified compaction is obtained. See Table 3 above for required testing frequency.

6.4 EXCAVATIONS & TRENCHES

All temporary slopes and excavations should conform to Occupational Safety and Health Administration (OSHA) Standards for the Construction Industry (29 CFR Part 1926, Subpart P). Excavations at this site are *expected* to be made in "Type C" clayey soil. Soil types should be verified in the field by a competent individual.

All excavations should be kept dry during subgrade preparation. Storm water runoff should be controlled and removed to prevent severe erosion of the subgrade and eliminate free standing water. Subgrade that has been rendered unsuitable from erosion or excessive wetting should be removed and replaced with controlled fill.

Trenches should be excavated so that pipes and culverts can be laid straight at uniform grade between the terminal elevations. Trench width should provide adequate working space and sidewall clearances. Trench subgrade should be removed and replaced with controlled fill if found to be wet, soft, loose, or frozen. Trench sub-grades should be compacted above 95% of the maximum dry density in accordance with ASTM D 698 at moisture contents between -3% to +3% of the optimum moisture content.

Granular bedding materials for pipes, such as well-graded sand or gravel, may be used provided that the bottom of the trench is graded so that water flows away from the structure.

Bedding material should be graded to provide a continuous support beneath all points of the pipe and joints. Embedment material should be deposited and compacted uniformly and simultaneously on each side of the pipe to prevent lateral displacement. Compacted control fill material will be required for the

full depth of the trench above the embedment material except in area landscape area with the compaction may be reduced to 90% Standard Proctor ASTM D 698. No backfill should be deposited or compacted in standing water.

Permanent slopes greater than 3 horizontals to 1 vertical should not be used unless additional testing and slope analysis is performed.

6.5 DRAINAGE AND DEWATERING

Normal seasonal weather conditions should be anticipated and planned for during earthwork. It is recommended that the Contractor determine the actual groundwater levels at the site at the time of the construction activities to assess the impact groundwater may have on construction. Water should not be allowed to collect in the foundation excavations, on floor slab areas, or on prepared subgrades of the construction area either during or after construction. Undercut or excavated areas should be sloped toward one corner to facilitate removal of collected rainwater, groundwater, or surface runoff. Positive site drainage should be provided to reduce infiltration of surface water around the perimeter of the building and beneath the floor slabs. The grades should be sloped away from the building and surface drainage should be collected and discharged such that water is not permitted to infiltrate the backfill and floor slab areas of the building.

The site should be graded such that positive drainage (normally 2% minimum) is provided away from any structures. Where sidewalks or paving do not immediately adjoin the building, protective slopes of at least 5% for a minimum of 10 feet from the perimeter walls are recommended. Roof drains and downpours should also be directed away from the building. Open-graded stone is not recommended for use under sidewalks unless the stone is adequately drained to prevent collection of water under the walks.

The site should also be graded to avoid water flows, concentrations, or pools behind retaining walls, curbs, or similar structures. When swales are designed at the top of the walls, proper line and slope should be considered to avoid any flow down behind walls. Special attention is needed for sources of storm water from slopes, building roofs, gutter downspouts and paved areas draining to one point.

Perforated plastic pipes should be placed on the backfilled side of the walls near the bottom and day lighted. Six inches of open graded crushed rock wrapped with geo-textile fabric should be placed behind the walls up to a depth of two feet below the finished grade. As an alternative to the open graded crushed rock, a manufactured geo-composite sheet drain such as Mirafi G100N, Contech C-Drain, or equivalent, may be used in conjunction with the perforated pipe.

6.6 LANDSCAPING

Landscaping and irrigation should be limited adjacent to buildings and pavements to reduce the potential for large moisture changes. Trees and large bushes can develop intricate root systems that can draw moisture from the subgrade, resulting in shrinkage of the bearing material during dry periods of the year. Desiccation of bearing material below foundations may result in foundation settlement.

Landscaped areas near pavements and sidewalks should include a drainage system that prevents over saturation of the subgrade beneath asphalt and concrete surfaces. Drainage systems in irrigation areas should be incorporated into the storm drain system.

7 GEOTECHNICAL ENGINEERING RECOMMENDATIONS

7.1 FOUNDATIONS RECOMMENDATIONS – RAMMED AGGREGATE PIERS

Due to the presence of undocumented fill, the existing subgrade materials, in their current state, are unsuitable for direct support of the planned structures' foundations. These existing conditions are such that a ground improvement system such as rammed aggregate piers (RAPs) are a suitable and recommended method to support conventional spread footings and the floor slab of the proposed buildings. CFS recommends that the RAP system be implemented under foundations and any interior load-bearing thickened slabs.

RAPs are used to improve the load carrying capacity of marginal soils by ramming aggregate into the unstable subgrade. Generally, a hole is first drilled into the subgrade and successive layers of aggregate are placed and driven into the unstable soils forming an "aggregate bulb" at the base, and thus providing lateral and vertical strengthening of the existing materials. RAPs are patented design-build intermediate foundation system. The respective companies should be contacted to design the foundation system.

In conjunction with the recommended ground improvement system, it is recommended that spread and trench footings have a minimum width of 24 and 16-inches, respectively. Footings should be suitably reinforced to reduce the effects of differential movement that may occur due to variations in the properties of the supporting soils. Top and bottom reinforcing steel is recommended for continuous wall footings to reduce differential settlement due to possible varying bearing capacities of the existing fill soils.

Every effort should be made to keep the footing excavations dry as the soils will tend to soften when exposed to free water. Footing bottoms should be free of loose soil and concrete should be placed as soon as possible to prevent drying of the foundation soils.

Based on the seasonal freeze-thaw cycles associated with the project site, shallow foundation systems should bear a minimum of 36-inches beneath the ground surface for adequate frost protection.

7.2 SEISMIC ANALYSIS

The determination of the seismic class is based on ASCE Standard 7: Minimum Design Loads for Building and Other Structures. Based upon this information, the seismic properties of the soil were interpolated from the standard penetration test values. A Seismic Site Class "D" was determined for this site. In addition, there is no significant risk of liquefaction or mass movement of the on-site soils due to a seismic event.

7.3 SLAB ON GRADE RECOMMENDATIONS

In its current state, the overburden materials (i.e., Fat Clay and undocumented fill) encountered during this exploration are unsuitable for direct support of the planned slab on grade. CFS recommends all concrete slabs on grade be supported by a minimum of 24-inches of Low Volume Change (LVC) material. LVC material should consist of KDOT AB3, crushed limestone screenings, or equivalent. A low volume change material is defined as a material with a liquid limit less than 45 and a plasticity index less than 25. The subgrade can be constructed as outlined below.

1. Cut the subgrade to a minimum depth of 24-inches beneath the planned bottom of slab elevation. The exposed material at this depth should be moisture conditioned and re-compacted, as necessary, to pass a proof roll as specified in Section 6.1, "Site Preparation" of this report.
2. Twenty (20) inches of compacted LVC material should be placed atop the exposed slab subgrade. The LVC should be placed in lifts no greater than 8-inches-thick (compacted thickness) and compacted to 95% of the maximum dry density as determined by ASTM 698. Limestone based LVC material should be compacted at a moisture content sufficient to achieve the desired compaction.
3. A 4-inch-thick layer of open graded stone (ASTM C33 or equivalent material) should be placed atop the 20-inches of compacted LVC material to return the subgrade to the original bottom of slab elevation. The open-graded stone will ease construction and provide a capillary break between the LVC and concrete slab.

A subgrade reaction modulus value of 150 psi/in can be used for 20-inches of compacted granular fill such as KDOT AB3, MODOT Type 5 or equivalent.

Every floor slab should be evaluated to determine if a vapor retarder under the concrete floor is required. The slab designer should refer to ACI 302 and/or ACI 360 for procedures regarding the use and placement of a vapor retarder.

To reduce the effects of differential movement, slabs-on-grade should not be rigidly connected to columns, walls, or foundations unless it is designed to withstand the additional resultant forces. Floor slabs should not extend beneath exterior doors or over foundation grade beams, unless saw cut at the beam after construction. Expansion joints may be used to allow unrestrained vertical movement of the slabs. The floor slabs should be designed to have an adequate number of joints to reduce cracking resulting from differential movement and shrinkage. CFS suggests joints be provided at a minimum spacing of twelve (12) feet on center. For additional recommendations refer to the ACI Design Manual. The requirements for the slab reinforcement should be established by the designer based on experience and the intended slab use.

7.4 LATERAL EARTH PRESSURES

Lateral earth pressures are determined by multiplying the vertical applied pressure by the appropriate lateral earth pressure coefficient. If the foundation walls are rigidly attached to the building and not free to rotate or deflect at the top, CFS recommends designing the walls for the *at-rest* earth pressure coefficient. Walls that are permitted to rotate and deflect at the top can be designed for the *active* lateral earth pressure condition. Horizontal loads acting on shallow foundations are resisted by friction

along the foundation base and by *passive* pressure against the footing face that is perpendicular to the line of applied force.

It is recommended that all walls be backfilled with open graded stone (such as No. 57 as referenced in ASTM C33) extending to two (2) feet behind the wall for the entire height of the wall to within 12-inches of the surface to allow for proper drainage and relief of any hydrostatic pressure build-ups that may occur in the native clay. The use of stone to backfill behind the walls will expedite construction, reduce potential settlement between the wall and the floor slab and lower the pressure induced on the wall from the backfill thus potentially reducing the thickness of the walls.

Table 6: Earth Pressure and Friction Coefficients

MATERIAL	ACTIVE (K_a)	PASSIVE (K_p)	AT-REST (K_o)	ALLOWABLE BASE FRICTION	UNIT WEIGHT (pcf)
Open-graded crushed limestone	0.27	3.69	0.43	0.47	130-140
In-situ lean clay soils	0.40	2.5	0.68	0.32	120-125
In-situ fat clay soils	0.49	2.04	0.66	0.24	120-125
Lean clay – conditioned and compacted	0.32	3.12	0.48	0.35	120-125
Fat clay/Weathered Shale – conditioned and compacted	0.45	2.2	0.63	0.27	120-130
Limestone Bedrock	-	-	-	0.55	140-150

These earth pressure coefficients do not include the effect of surcharge loads, hydrostatic loading, or a sloping backfill. Nor do they incorporate a factor of safety. Also, these earth pressure coefficients do not account for high lateral pressures that may result from volume changes when expansive clay soils are used as backfill behind walls with unbalanced fill depths. In addition, any disturbed soils that are relied upon to provide some level of passive resistance should be placed in lifts not exceeding six (6) inches in thickness and compacted to a minimum density of 95% of the Standard Proctor (ASTM D698) maximum dry density at a moisture content within +/- 3% of the optimum moisture content. It is recommended that a representative of CFS should verify the compaction of any such materials relied upon to provide passive pressure.

The actual earth pressure on the walls will vary according to material types and backfill materials used and how the backfill is compacted. If the backfill conditions are different than the ones used above, CFS should be notified so the recommendations can be modified. The buildup of water behind a wall will increase the lateral pressure imposed on below-grade walls. Adequate drainage should be provided behind any below grade walls as described in this report. The walls should also be designed for appropriate surcharge pressures such as adjacent traffic, interior building floor slab loads, and construction equipment.

7.5 PAVEMENT RECOMMENDATIONS

The pavement sections presented below are considered typical and minimum for the report basis parameters. The client should be aware that thinner pavement sections might result in increased maintenance costs and lower than anticipated pavement life. The pavement area subgrade consists of moisture sensitive soils. CFS should evaluate the existing fill material prior to pavement construction. Over-excavation and replacement may be necessary to achieve a suitable, uniform sub-grade due to the presence of undocumented fill. CFS does not expect this to exceed two (2) feet in depth, if necessary.

The soils expected beneath the pavement are clay based. Please note clays tend to expand and contract with changes in moisture and weather conditions, and they are considered very moisture susceptible, losing strength quickly. If moisture becomes an issue during construction, or stability of the subgrade soils does not meet the requirements of this report (i.e., pass a proof roll as outline in Section 6.1), the on-site soils can be stabilized with Portland Cement mixed at a concentration of 5% by dry unit weight to a depth of 9-inches. See Section 7.5.1 for more information on cement stabilization requirements. Additionally, If the client prefers to use Portland cement stabilized soils, the pavement sections below can be re-evaluated and possibly reduced.

Table 6: Recommended Light Duty Pavement Sections (Parking lots)

RECOMMENDED THICKNESSES (INCHES) – LIGHT DUTY			
Asphalt		Concrete	
APWA Type 3-01 AC Surface	2	Concrete	6
APWA Type 1-01 AC Base ⁽²⁾	3	Aggregate Base Course	4
Aggregate Base Course ⁽¹⁾	6	Moisture Conditioned & Recompacted Subgrade (LL<55, PI<30, See Section 7.5.1)	12
Moisture Conditioned & Recompacted Subgrade (LL<55, PI<30, See Section 7.5.1)	12		

(1) 9-inches of cement stabilization can be used in lieu of the aggregate base course beneath asphalt unless LL>55 condition exists. If LL>55, both cement stabilization and aggregate base course should be utilized.

(2) When base is to be placed in the fall and surface in the spring, APWA Type 2-01 is recommended to improve performance of base due to lower permeability.

Table 7: Heavy Duty Pavement Thicknesses (Truck areas and drives)

RECOMMENDED THICKNESSES (INCHES) – HEAVY DUTY			
Asphalt		Concrete	
APWA Type 3-01 AC Surface	2	Concrete ⁽³⁾	8
APWA Type 1-01 AC Base ⁽²⁾	6	Aggregate Base Course	6
Aggregate Base Course ⁽¹⁾	6	Moisture Conditioned & Recompacted Subgrade (LL<55, PI<30, See Section 7.5.1)	12
Moisture Conditioned & Recompacted Subgrade (LL<55, PI<30, See Section 7.5.1)	12		

(1) 9-inches of cement stabilization can be used in lieu of the aggregate base course beneath asphalt unless LL>55 condition exists. If LL>55, both cement stabilization and aggregate base course should be utilized.

(2) When base is to be placed in the fall and surface in the spring, APWA Type 2-01 is recommended to improve performance of base due to lower permeability.

(3) 8-inches of concrete is recommended for trash and/or recycling dumpster areas.

7.5.1 Pavement Subgrade Preparation

The upper 12-inches of exposed subgrade, extended a minimum of two (2) feet laterally beyond all pavement lines, should be moisture conditioned and recompacted, as necessary, to pass a proof roll evaluation as described in Section 6.1, "Site preparation" of this report.

Any localized soft, wet, or loose areas identified during the proof rolling should be repaired prior to paving. Fill material should be placed in loose lifts up to a maximum of eight (8) inches in thickness and compacted to at least 95% of the maximum dry density in accordance with ASTM D698 at moisture contents outlined in the Earthwork section. Construction traffic should be minimized to prevent unnecessary disturbance of the pavement subgrade. Disturbed areas, as verified by CFS's geotechnical engineer, should be removed, and replaced with properly compacted material.

Fat clays (CH) with Liquid Limits of greater than 55 should not be used in the upper one (1) foot beneath the pavement section without being treated with Type 1/2 Portland cement to a minimum depth of 9-inches at a concentration of 5% by dry unit weight as determined by ASTM D698. When used for this purpose, this treatment is considered in addition to the recommended granular base included in the pavement sections above. However, Consideration should be given to treating all non-LVC clays so as to extend the life of the pavement, improve performance and reduce maintenance costs. Any cement stabilization should be compacted to 95% of the material's dry unit weight at a moisture content between 0 and +4% of the material's optimum moisture content as determined by ASTM D698. The materials should be compacted in loose lifts not exceeding twelve (12) inches in thickness. Compaction and moisture requirements should be achieved within two (2) hours of mixing. Cement treated subgrades should be protected from construction traffic, freezing, and drying for a minimum of 5 days after mixing.

7.5.2 Aggregate Base Course

The aggregate base recommended in the pavement sections above should be placed in loose lifts not exceeding six (6) inches in thickness and should extend a minimum lateral distance of two (2) feet beyond the pavement lines. This extra width is structurally beneficial for wheel loads applied at pavement edge. The granular base should be compacted to at least 95% of the maximum dry density in accordance with ASTM D698.

If open graded stone is used under the pavement, the pavement subgrade should be graded to provide positive drainage of the granular base section. Please note, open graded stone is recommended beneath concrete pavements. Provision should be made to provide drainage into the storm water system. The use of a granular blanket drain near storm water inlets that provides weep holes from the drain to the inlets is recommended.

7.5.3 Asphalt Pavement Construction

Asphalt cement (bitumen) used in the manufacture of asphalt pavement should conform to the Performance Grading system. In the project area, the provincial grade asphalt binder course is PG 64-22. The asphaltic mix for conventional roadway should be designed for 4% air voids. During production, the voids can be expected to vary $\pm 1\%$ of the design value of 4%. Under these conditions, the minimum allowable VMA for base and surface course shall be 12% and 14%, respectively.

Immediately after spreading, each course of the pavement mixture should be compacted by rolling. The initial or "breakdown" rolling shall be accomplished with a steel-wheeled vibratory roller. The motion of the roller should be slow enough at all times to avoid displacement of the hot mixture. The surface of the mixture after compaction should be smooth and true to established section and grade. The completed asphalt concrete paving should have a density equal to or greater than 95% for the base and 96% for the surface of theoretical density.

All asphaltic concrete mix designs and Marshall Characteristics should be submitted to CFS and reviewed in order to determine if they are consistent with the recommendations given in this report. All materials to be employed and field operations required in connection with the pavement reconstruction should follow requirements and procedural details as per APWA 2001. In addition, representative of CFS should observe and monitor the pavement construction to assure satisfactory compliance with these engineering recommendations.

Please note, regular maintenance inclusive of chip and crack sealing should be anticipated with all asphaltic pavement designs.

7.5.4 Concrete Pavement Construction

The pavement on this site will be subjected to freeze-thaw cycles. Sufficient air entrainment in the range of 6% to 8% is required to provide freeze-thaw durability in the concrete. Concrete with a 28-day specified compressive strength of 4,000 psi is recommended. The concrete mix should contain at least 564 pounds of concrete per cubic yard. A mixture with a maximum slump of 4 inch +/- 1 inch is acceptable. If a water-reducing admixture is specified, slump can be higher. For better performance and crack control, synthetic fiber reinforcement such as Fibermesh® 300 is recommended for the concrete instead of welded wire mesh. Add synthetic fiber reinforcement to concrete mixture in accordance with manufacturer's instructions.

8 GENERAL COMMENTS


When the plans and specifications are complete, or if significant changes are made in the character or location of the proposed building, a consultation should be arranged to review the changes with respect to the prevailing soil conditions. At that time, it may be necessary to submit supplementary recommendations.

It is recommended that the services of Cook, Flatt & Strobel Engineers be engaged to test and evaluate the compaction of any additional fill materials and to test and evaluate the bearing value of the soils in the footing excavations.

Respectfully submitted,

COOK, FLATT & STROBEL ENGINEERS, P.A.

Jacob Engler, P.E.
Geotechnical Engineer

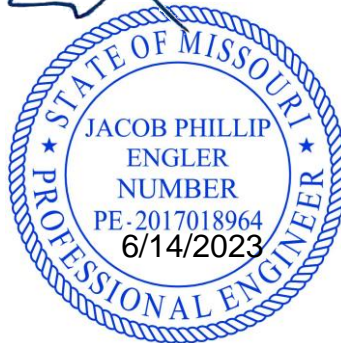

Reviewed by: Adam McEachron, P.E.
Senior Geotechnical Engineer

Appendix A: Figures



1100 W. Cambridge Circle Dr, Ste 700
Kansas City, Kansas 66103

Project: **WOODSPRINGS SUITES**

Project Location: Lee's Summit, MO

Client: Genesis Companies


Date: 6/14/2023

Project #: 22-5831

Comments:

Figure 1:

SITE LOCATION PLAN

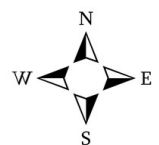

shutterstock.com · 1348278950



1100 W. Cambridge Circle Dr, Ste 700
Kansas City, Kansas 66103

Project: **WOODSPRINGS SUITES**

Project Location: Lee's Summit, MO

Client: Genesis Companies

Date: 6/14/2023

Project #: 22-5831

Comments:

Figure 2: **BORING LOCATION PLAN**



shutterstock.com · 1340278950

Appendix B: Boring Logs



CFS Engineers, Inc
1100 W. Cambridge Circle Drive, Suite 700
Kansas City, Kansas 66103

CLIENT Genesis Companies

PROJECT NAME WOODSPRINGS APTS

PROJECT NUMBER 22-5831

PROJECT LOCATION Lee's Summit, Missouri

DATE STARTED 06/09/23 COMPLETED 06/09/23

GROUND ELEVATION _____ HOLE SIZE 3.25 inches

DRILLING CONTRACTOR CFS Engineers

GROUND WATER LEVELS:

DRILLING METHOD 3.25-inch Continuous Flight

AT TIME OF DRILLING --- No Free Water Encountered

LOGGED BY NG CHECKED BY JE

AT END OF DRILLING --- No Free Water Encountered

NOTES _____

AFTER DRILLING --- No Free Water Encountered

DEPTH (ft)	GRAPHIC LOG	MATERIAL DESCRIPTION	SAMPLE TYPE NUMBER	RECOVERY % (RQD)	BLOW COUNTS (N VALUE)	POCKET PEN. (tsf)	DRY UNIT WT. (pcf)	MOISTURE CONTENT (%)	ATTERBERG LIMITS			UNCONFINED COMP (PSF)
									LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	
0		(GW) GRAVEL AND ASPHALT with clay mixed										
		(GW) ROCK FILL with clay mixed										
		FAT CLAY, (CH) brown and blueish gray, moist, medium stiff, with gravel (FILL)	SPT 1	44	2-3-3 (6)	2.25		26.4				
5		(CH) stiff below 6'	SPT 2	100	2-4-4 (8)	2.25		22.6				
		(CH) medium stiff below 8'	SPT 3	89	3-2-3 (5)	2.75		22.2				
10												
		(CH) stiff and dark brown below 13'	SPT 4	94	4-4-4 (8)	4.5		22.7				
15												
			SPT 5	100	4-5-6 (11)	2.5		24.3				
20												

Bottom of borehole at 20.0 feet.

GEOTECH BH COLUMNS - GINT STD US LAB.GDT - 06/14/23 15:06 - G:\SHARED DRIVES\225831\GEOTECH\EXPLORATION REPORTS\22-5831 WOODSPRINGS APTS (1).GPJ



CFS Engineers, Inc
1100 W. Cambridge Circle Drive, Suite 700
Kansas City, Kansas 66103

CLIENT Genesis Companies

PROJECT NAME WOODSPRINGS APTS

PROJECT NUMBER 22-5831

PROJECT LOCATION Lee's Summit, Missouri

DATE STARTED 06/09/23 COMPLETED 06/09/23

GROUND ELEVATION _____ HOLE SIZE 3.25 inches

DRILLING CONTRACTOR CFS Engineers

GROUND WATER LEVELS:

DRILLING METHOD 3.25-inch Continuous Flight

▽ AT TIME OF DRILLING 2.00 ft Suspected Relic Utility Trench

LOGGED BY NG CHECKED BY JE

▼ AT END OF DRILLING 0.00 ft

NOTES _____

AFTER DRILLING --- Not Recorded

DEPTH (ft)	GRAPHIC LOG	MATERIAL DESCRIPTION	SAMPLE TYPE NUMBER	RECOVERY % (RQD)	BLOW COUNTS (N VALUE)	POCKET PEN. (tsf)	DRY UNIT WT. (pcf)	MOISTURE CONTENT (%)	ATTERBERG LIMITS			UNCONFINED COMP (PSF)
									LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	
0		(GW) 3-inches of GRAVEL (GW) ROCK FILL with clay mixed										
		FAT CLAY, (CH) brown and blueish gray, moist, medium stiff, with gravel (FILL)	SPT 1	89	2-2-4 (6)	2		26.2				
5			SPT 2	78	2-2-3 (5)	1.25		30.2				
			SPT 3	100	2-2-3 (5)	1.75		27.8				
10		(CH) stiff, dark brown and brown below 8'	SPT 4	94	2-3-5 (8)	2.5		26.0				
15			SPT 5	100	3-6-6 (12)	2.5		25.1				
20		FAT CLAY, (CH) gray and brown, moist, stiff	SPT 6	100	3-4-5 (9)	1		32.9				

Bottom of borehole at 20.0 feet.

GEOTECH BH COLUMNS - GINT STD US LAB.GDT - 06/14/23 15:06 - G:\SHARED DRIVES\225831\GEOTECH\EXPLORATION REPORTS\22-5831 WOODSPRINGS APTS (1).GPJ



CFS Engineers, Inc
1100 W. Cambridge Circle Drive, Suite 700
Kansas City, Kansas 66103

CLIENT Genesis Companies

PROJECT NAME WOODSPRINGS APTS

PROJECT NUMBER 22-5831

PROJECT LOCATION Lee's Summit, Missouri

DATE STARTED 06/09/23 COMPLETED 06/09/23

GROUND ELEVATION _____ HOLE SIZE 3.25 inches

DRILLING CONTRACTOR CFS Engineers

GROUND WATER LEVELS:

DRILLING METHOD 3.25-inch Continuous Flight

AT TIME OF DRILLING --- No Free Water Encountered

LOGGED BY NG CHECKED BY JE

AT END OF DRILLING --- No Free Water Encountered

NOTES _____

AFTER DRILLING --- No Free Water Encountered

DEPTH (ft)	GRAPHIC LOG	MATERIAL DESCRIPTION	SAMPLE TYPE NUMBER	RECOVERY % (RQD)	BLOW COUNTS (N VALUE)	POCKET PEN. (tsf)	DRY UNIT WT. (pcf)	MOISTURE CONTENT (%)	ATTERBERG LIMITS			UNCONFINED COMP (PSF)
									LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	
0		(GW) GRAVEL AND ASPHALT										
		(GP) GRAVEL AND WATER INFILTRATION AT 2' (possible old utility trench)										
		LEAN CLAY, (CL) brown and reddish brown, moist, stiff, with gravel (FILL)										
5			SPT 1	72	2-4-4 (8)	2.25		24.1	45	22	23	
		(CL) medium stiff below 6'	SPT 2	56	2-3-4 (7)	2.25		30.1				
10			SPT 3	39	2-3-3 (6)	3.75		22.1				
		(CL) stiff below 13'	SPT 4	17	4-6-7 (13)	.5		26.4				
15												
		(CL) dark brown below 18'	SPT 5	100	5-5-5 (10)	1.5		26.5				
20												

Bottom of borehole at 20.0 feet.

GEOTECH BH COLUMNS - GINT STD US LAB.GDT - 06/14/23 15:06 - G:\SHARED DRIVES\225831\GEOTECH\EXPLORATION REPORTS\22-5831 WOODSPRINGS APTS (1).GPJ



CFS Engineers, Inc
1100 W. Cambridge Circle Drive, Suite 700
Kansas City, Kansas 66103

CLIENT Genesis Companies

PROJECT NAME WOODSPRINGS APTS

PROJECT NUMBER 22-5831

PROJECT LOCATION Lee's Summit, Missouri

DATE STARTED 06/12/23 COMPLETED 06/12/23

GROUND ELEVATION _____ HOLE SIZE 3.25 inches

DRILLING CONTRACTOR CFS Engineers

GROUND WATER LEVELS:

DRILLING METHOD 3.25-inch Continuous Flight

AT TIME OF DRILLING --- No Free Water Encountered

LOGGED BY NG CHECKED BY JE

AT END OF DRILLING --- No Free Water Encountered


NOTES _____

AFTER DRILLING --- No Free Water Encountered

GEOTECH BH COLUMNS - GINT STD US LAB.GDT - 06/14/23 15:06 - G:\SHARED DRIVES\225831\GEOTECH\EXPLORATION REPORTS\22-5831 WOODSPRINGS APTS (1).GPJ

DEPTH (ft)	GRAPHIC LOG	MATERIAL DESCRIPTION	SAMPLE TYPE NUMBER	RECOVERY % (RQD)	BLOW COUNTS (N VALUE)	POCKET PEN. (tsf)	DRY UNIT WT. (pcf)	MOISTURE CONTENT (%)	ATTERBERG LIMITS			UNCONFINED COMP (PSF)
									LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	
0		(GW) GRAVEL AND ASPHALT with clay mixed										
		FAT CLAY, (CH) blueish gray and reddish brown, moist, medium stiff, (possible FILL)	SPT 1	72	3-3-4 (7)	1.75		28.0				
		(CH) gray and brown below 3'	SPT 2	67	2-2-4 (6)	2.25		22.6				
5												

Bottom of borehole at 5.0 feet.



PAGE 1 OF 1

CLIENT <u>Genesis Companies</u>	PROJECT NAME <u>WOODSPRINGS APTS</u>
PROJECT NUMBER <u>22-5831</u>	PROJECT LOCATION <u>Lee's Summit, Missouri</u>
DATE STARTED <u>06/12/23</u> COMPLETED <u>06/12/23</u>	GROUND ELEVATION _____ HOLE SIZE <u>3.25 inches</u>
DRILLING CONTRACTOR <u>CFS Engineers</u>	GROUND WATER LEVELS:
DRILLING METHOD <u>3.25-inch Continuous Flight</u>	AT TIME OF DRILLING <u>--- No Free Water Encountered</u>
LOGGED BY <u>NG</u> CHECKED BY <u>JE</u>	AT END OF DRILLING <u>--- No Free Water Encountered</u>
NOTES	AFTER DRILLING <u>--- No Free Water Encountered</u>

[illegible]

Bottom of borehole at 5.0 feet.

G:\GEOTECH\BH COLUMNS - GINT STD US LAB\GDT - 06\14\23 15:06 - G:\SHARED DRIVES\22583\GEOTECH\EXPLORATION REPORTS\22-583\ WOODSPRINGS APTS (1).GPJ



CFS Engineers, Inc
1100 W. Cambridge Circle Drive, Suite 700
Kansas City, Kansas 66103

CLIENT Genesis Companies

PROJECT NAME WOODSPRINGS APTS

PROJECT NUMBER 22-5831

PROJECT LOCATION Lee's Summit, Missouri

DATE STARTED 06/12/23 COMPLETED 06/12/23

GROUND ELEVATION _____ HOLE SIZE 3.25 inches

DRILLING CONTRACTOR CFS Engineers

GROUND WATER LEVELS:

DRILLING METHOD 3.25-inch Continuous Flight

AT TIME OF DRILLING --- No Free Water Encountered

LOGGED BY NG CHECKED BY JE

AT END OF DRILLING --- No Free Water Encountered

NOTES _____

AFTER DRILLING --- No Free Water Encountered

GEOTECH BH COLUMNS - GINT STD US LAB.GDT - 06/14/23 15:06 - G:\SHARED DRIVES\225831\GEOTECH\EXPLORATION REPORTS\22-5831 WOODSPRINGS APTS (1).GPJ

DEPTH (ft)	GRAPHIC LOG	MATERIAL DESCRIPTION	SAMPLE TYPE NUMBER	RECOVERY % (RQD)	BLOW COUNTS (N VALUE)	POCKET PEN. (tsf)	DRY UNIT WT. (pcf)	MOISTURE CONTENT (%)	ATTERBERG LIMITS			UNCONFINED COMP (PSF)
									LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	
0												
		(GW) GRAVEL FILL with clay mixed FAT CLAY, (CH) tan, moist, medium stiff, with gravel and asphalt (FILL)	SPT 1	78	9-3-3 (6)	1.25		28.6				
			SPT 2	39	1-2-2 (4)	0		30.2				
5												

Bottom of borehole at 5.0 feet.



CFS Engineers, Inc
1100 W. Cambridge Circle Drive, Suite 700
Kansas City, Kansas 66103

CLIENT Genesis Companies

PROJECT NAME WOODSPRINGS APTS

PROJECT NUMBER 22-5831

PROJECT LOCATION Lee's Summit, Missouri

DATE STARTED 06/12/23 COMPLETED 06/12/23

GROUND ELEVATION _____ HOLE SIZE 3.25 inches

DRILLING CONTRACTOR CFS Engineers

GROUND WATER LEVELS:

DRILLING METHOD 3.25-inch Continuous Flight

AT TIME OF DRILLING --- No Free Water Encountered

LOGGED BY NG CHECKED BY JE

AT END OF DRILLING --- No Free Water Encountered

NOTES _____

AFTER DRILLING --- No Free Water Encountered

GEOTECH BH COLUMNS - GINT STD US LAB.GDT - 06/14/23 15:06 - G:\SHARED DRIVES\225831\GEOTECH\EXPLORATION REPORTS\22-5831 WOODSPRINGS APTS (1).GPJ

DEPTH (ft)	GRAPHIC LOG	MATERIAL DESCRIPTION	SAMPLE TYPE NUMBER	RECOVERY % (RQD)	BLOW COUNTS (N VALUE)	POCKET PEN. (tsf)	DRY UNIT WT. (pcf)	MOISTURE CONTENT (%)	ATTERBERG LIMITS			UNCONFINED COMP (PSF)
									LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	
0		(GW) GRAVEL AND ASPHALT with clay mixed										
		FAT CLAY, (CH) brown and dark brown, moist, stiff, with gravel (FILL)	SPT 1	72	2-4-5 (9)	3		24.7				
		(CH) medium stiff below 3'										
			SPT 2	67	2-3-3 (6)	1.5		28.8				
5												

Bottom of borehole at 5.0 feet.



CFS Engineers, Inc
1100 W. Cambridge Circle Drive, Suite 700
Kansas City, Kansas 66103

CLIENT Genesis Companies

PROJECT NAME WOODSPRINGS APTS

PROJECT NUMBER 22-5831

PROJECT LOCATION Lee's Summit, Missouri

DATE STARTED 06/12/23 COMPLETED 06/12/23

GROUND ELEVATION _____ HOLE SIZE 3.25 inches

DRILLING CONTRACTOR CFS Engineers

GROUND WATER LEVELS:

DRILLING METHOD 3.25-inch Continuous Flight

AT TIME OF DRILLING --- No Free Water Encountered

LOGGED BY NG CHECKED BY JE

AT END OF DRILLING --- No Free Water Encountered

NOTES _____

AFTER DRILLING --- No Free Water Encountered

GEOTECH BH COLUMNS - GINT STD US LAB.GDT - 06/14/23 15:06 - G:\SHARED DRIVES\225831\GEOTECH\EXPLORATION REPORTS\22-5831 WOODSPRINGS APTS (1).GPJ

DEPTH (ft)	GRAPHIC LOG	MATERIAL DESCRIPTION	SAMPLE TYPE NUMBER	RECOVERY % (RQD)	BLOW COUNTS (N VALUE)	POCKET PEN. (tsf)	DRY UNIT WT. (pcf)	MOISTURE CONTENT (%)	ATTERBERG LIMITS			UNCONFINED COMP (PSF)
									LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	
0		(GW) GRAVEL AND ASPHALT with clay mixed										
		FAT CLAY, (CH) brown, moist, medium stiff, with gravel (FILL)	SPT 1	78	3-3-4 (7)	2.25		27.5				
5			SPT 2	39	3-3-3 (6)	1		28.5				

Bottom of borehole at 5.0 feet.